

General Information

Date & Time: 19, Feb, 2026 15:57

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	8,390
Registration No.	DBQ9709	Chassis No.	PA1B18F32R4253725
CC	1.3	Transmission	M/T
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



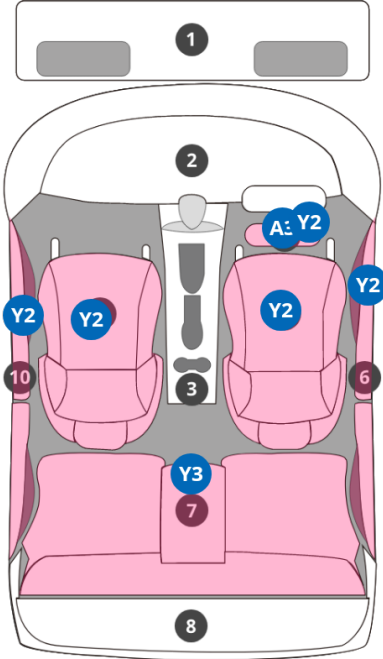
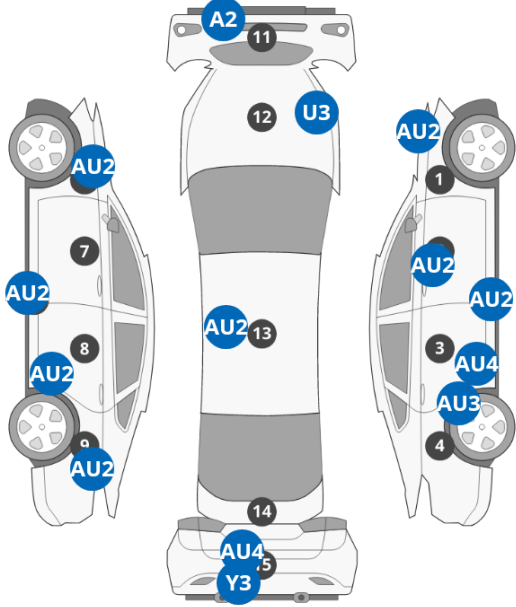
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.0	101	131	119
2	Boot Lid	116.3	114	110	125
3	Roof	98.5	112	91	91/101
4	Left Front Fender	98.8	99	98	100
5	Left Front Door	101.7	102	106	97
6	Center Panel Left				
7	Left Rear Door	102.9	100	98	111
8	Left Back Panel	103.4	111	104	95
9	Right Front Fender	103.3	108	102	100
10	Right Front Door	105.0	96	105	114
11	Center Panel Right				
12	Right Rear Door	104.3	107	105	101
13	Right Back Panel	99.7	108	92	99

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium</p>	<p>Remarks Roof - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with jack, with manual and warranty booklet, no spare key, no reverse camera, scratches on taillight and headlight.</p>