

General Information

Date & Time: 18, Feb, 2026 17:38

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	31,522
Registration No.	DBR9738	Chassis No.	PA1B18F30R4280602
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



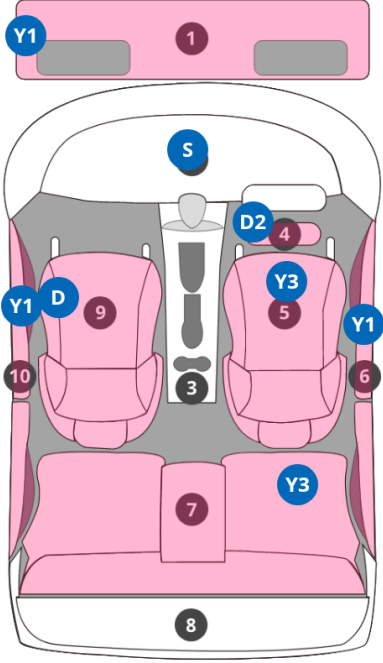
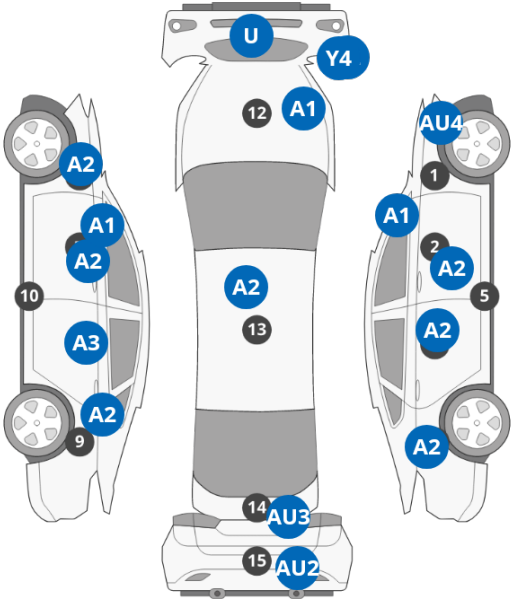
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	116.0	117	115	116
2	Boot Lid	114.3	113	101	129
3	Roof	109.2	105	113	102/117
4	Left Front Fender	102.9	100	110	99
5	Left Front Door	107.6	106	108	109
6	Center Panel Left				
7	Left Rear Door	105.6	106	106	105
8	Left Back Panel	120.0	139	111	110
9	Right Front Fender	106.6	109	105	106
10	Right Front Door	116.6	117	125	108
11	Center Panel Right				
12	Right Rear Door	112.6	111	109	118
13	Right Back Panel	108.6	109	103	114

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Worn - Yes / Ceiling - Grime - Minimal / Overall Interior - Smell - Yes</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Mirror - Scratch - Minimal / Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Modified - Small / Front Bumper, Grille, Lamps - Crack, Gap - Large / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>no warranty booklet, with jack and tools, with spare tire, with LTO plate, scratched and cracked tail light, power steering issue due to weak battery</p>