

General Information

Date & Time: 19, Feb, 2026 10:36

Make	Toyota	Model	Wigo
YOM	2023	Odo Meter Reading	19,596
Registration No.	NFC7587	Chassis No.	MHKAA1BCXPJ001567
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Gray		

Body / Panel Condition



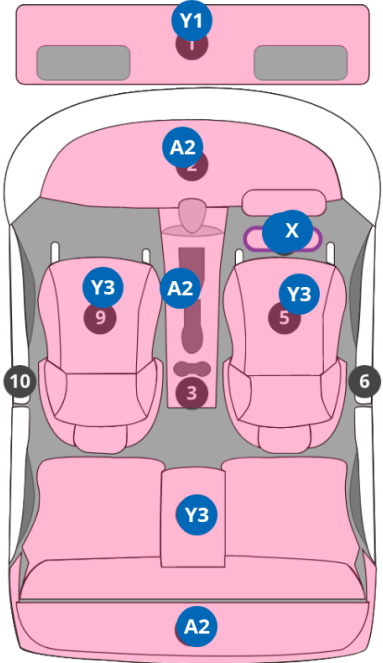
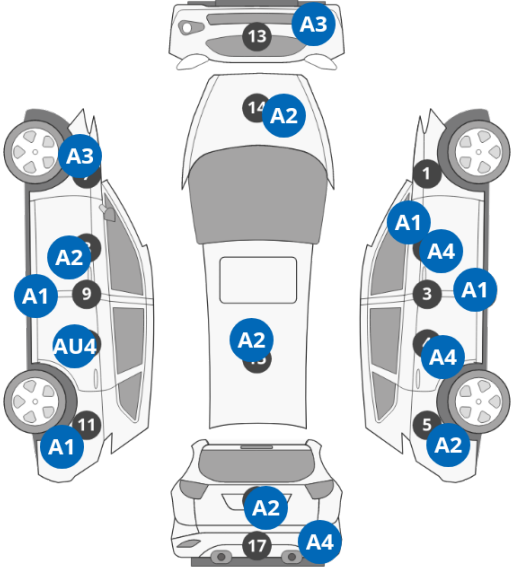
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	110	113	110
2	Boot Lid	80.8	82	87	74
3	Roof	77.6	75	77	85/74
4	Left Front Fender	95.2	92	92	101
5	Left Front Door	103.3	100	102	108
6	Center Panel Left				
7	Left Rear Door	104.0	113	97	102
8	Left Back Panel	92.9	95	92	92
9	Right Front Fender	91.6	98	94	83
10	Right Front Door	102.5	114	100	94
11	Center Panel Right				
12	Right Rear Door	94.5	96	89	99
13	Right Back Panel	89.2	97	85	85

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Ceiling - Grime - Minimal / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small / Dashboard - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Medium / (R) Mirror - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / Roof - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 2 key/with reverse camera/with jack and tools/No warranty booklets/No seat cover/front left and right floor mats missing/</p>