

General Information

Date & Time: 19, Feb, 2026 10:35

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	15,543
Registration No.	NFR5964	Chassis No.	PA1B18F39R4253110
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



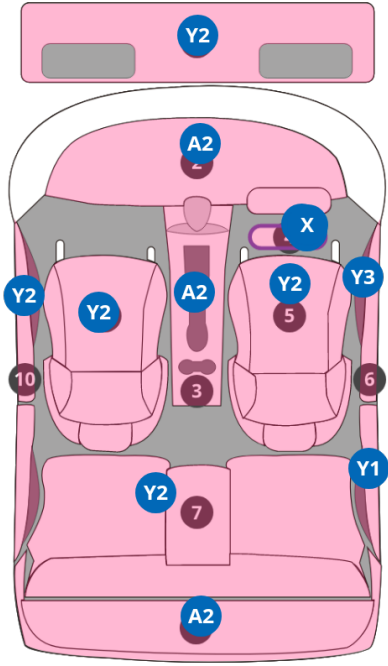
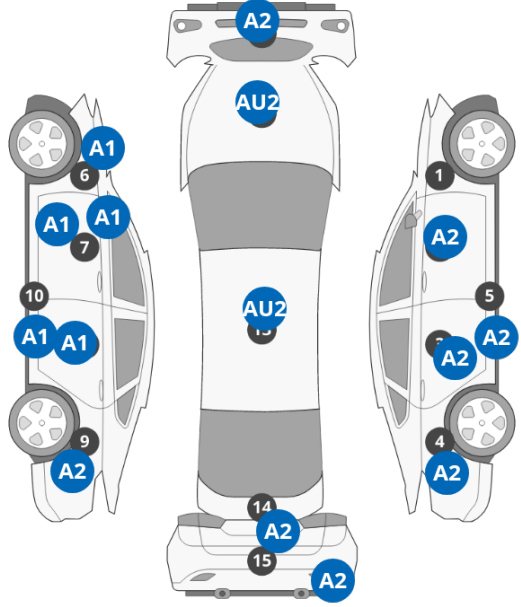
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	150.0	158	147	145
2	Boot Lid	127.0	127	125	129
3	Roof	125.5	137	135	118/112
4	Left Front Fender	135.6	131	155	121
5	Left Front Door	131.0	133	134	126
6	Center Panel Left				
7	Left Rear Door	133.0	142	129	128
8	Left Back Panel	134.6	144	127	133
9	Right Front Fender	151.3	156	153	145
10	Right Front Door	102.3	114	100	93
11	Center Panel Right				
12	Right Rear Door	117.0	111	116	124
13	Right Back Panel	127.0	125	125	131

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Medium / (R) Rear Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Ceiling - Grime - Small / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and incomplete tools/with warranty booklet/with reverse/No seat cover/front right sid3 door stickers issue/front and rear floor mat missing/</p>