

General Information

Date & Time: 18, Feb, 2026 18:39

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	24,706
Registration No.	NHR9308	Chassis No.	PA1B18F33P4235473
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



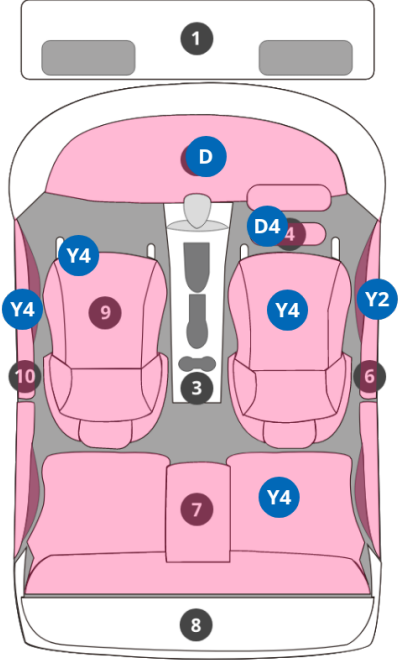
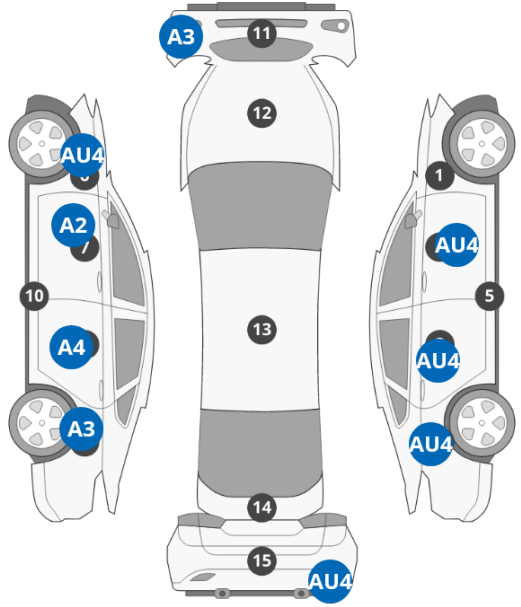
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	102.0	107	98	101
2	Boot Lid	102.8	99	105	104
3	Roof	91.9	94	94	83/98
4	Left Front Fender	90.6	89	87	96
5	Left Front Door	94.3	89	96	98
6	Center Panel Left				
7	Left Rear Door	92.2	93	93	90
8	Left Back Panel	97.2	97	100	95
9	Right Front Fender	93.0	97	91	92
10	Right Front Door	103.4	107	106	97
11	Center Panel Right				
12	Right Rear Door	100.5	102	98	102
13	Right Back Panel	105.1	94	98	123

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Seat - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Floor Mat - Worked - Large</p>	<p>Remarks (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ incomplete tools/ possible flooding/ with jack and spare tire/ with LTO plate/</p>