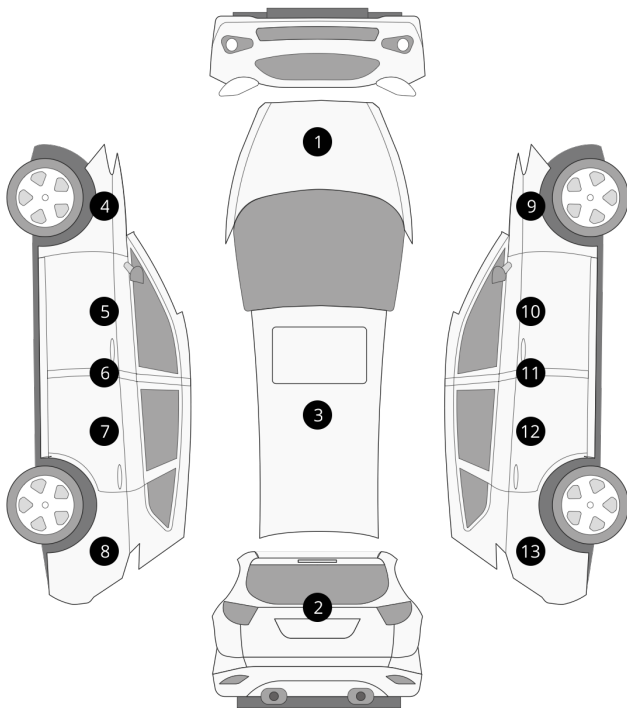


General Information

Date & Time: 01, Feb, 2025 08:58

Make	Kia	Model	Carnival
YOM	2008	Mileage	187,453
Registration No.	ZMU225	Chassis No.	KNAMB751388251363
CC	2.9	Transmission	A/T
Fuel Type	Gas	Type of Body	Mini Van
Colour	Silver		

Body / Panel Condition



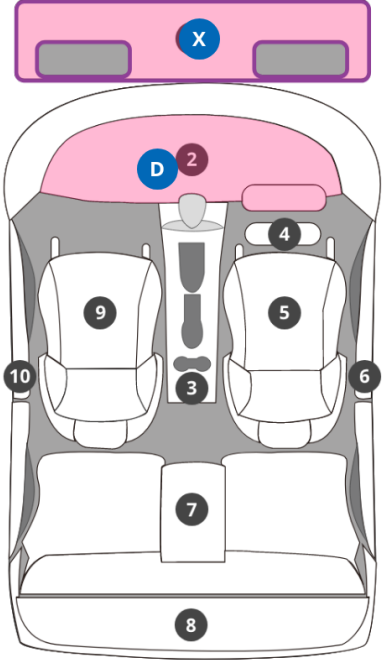
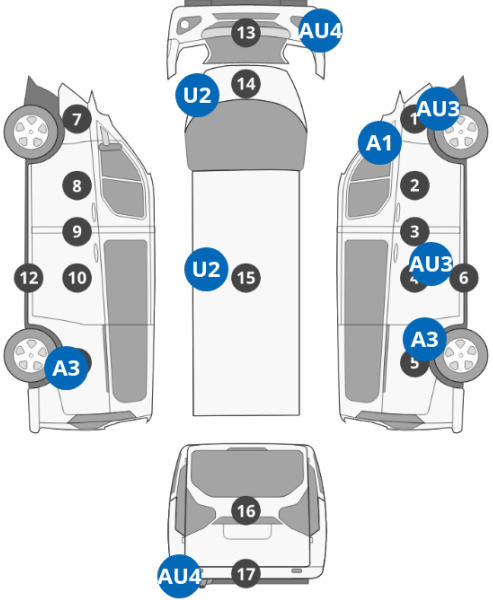
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	174.6	192	172	160
2	Boot Lid	155.0	146	142	177
3	Roof	128.5	121	138	124/131
4	Left Front Fender	147.3	152	152	138
5	Left Front Door	140.0	121	138	161
6	Center Panel Left				
7	Left Rear Door	144.0	155	141	136
8	Left Back Panel	262.0	501	161	124
9	Right Front Fender	713.3	1,110	450	580
10	Right Front Door	189.3	206	174	188
11	Center Panel Right				
12	Right Rear Door	784.6	824	1,237	293
13	Right Back Panel	419.0	183	618	456

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Overall Interior - Worn as per age - Yes / Sunvisor, Sunglass Holder - Missing - Yes / Room Lamp - Partially Missing - Yes / Switchs - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch - Medium / Roof - Dent - Small / Bonnet, Headlight - Dent - Small / (R) Mirror - Scratch, Peeled - Minimal
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Door Lock - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with jack and tools/ no spare tire/ no warranty booklet/ hard starting/ engine leak/ driver door hand issue/ no reverse camera/ rear wiper issue/ worn tires/ doors are hard to open/ yellowing of headlight