

General Information

Date & Time: 20, Feb, 2026 10:09

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	21,927
Registration No.	NJF6187	Chassis No.	PA1B18F34S4283962
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



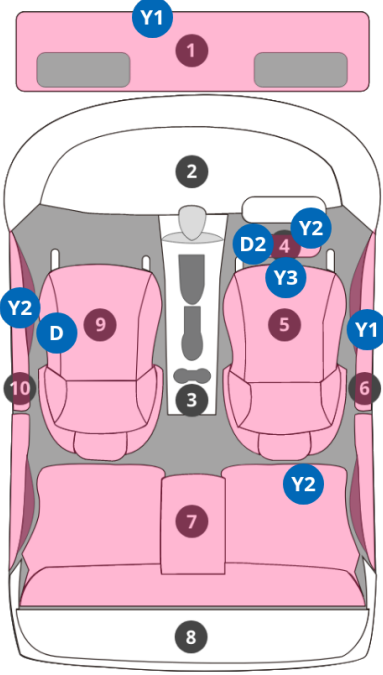
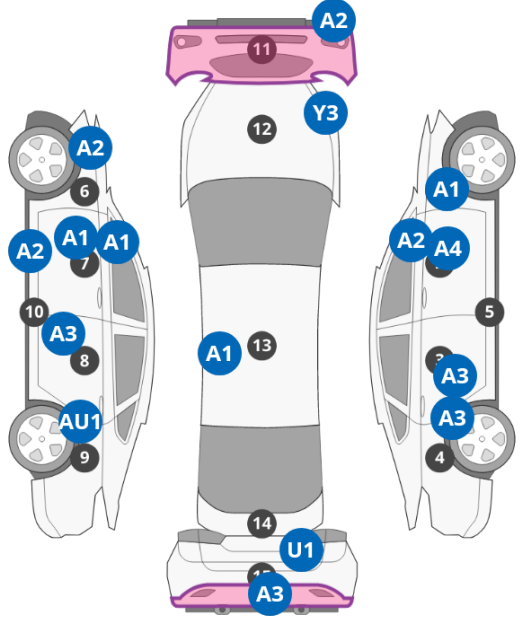
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	181.6	176	165	204
2	Boot Lid	236.6	238	216	256
3	Roof	211.7	230	202	199/216
4	Left Front Fender	108.0	113	108	103
5	Left Front Door	266.6	341	233	226
6	Center Panel Left				
7	Left Rear Door	151.6	152	156	147
8	Left Back Panel	225.6	236	234	207
9	Right Front Fender	93.1	96	93	91
10	Right Front Door	172.6	168	169	181
11	Center Panel Right				
12	Right Rear Door	162.0	165	160	161
13	Right Back Panel	209.0	211	194	222

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (L) Front Floor Mat - Worked - Small / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Small / Rear Seat - Grime - Small / (R) Front Floor Mat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Medium / Overall Exterior - Full Re-Paint in same color - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Crack, Gap - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Roof - Scratch - Minimal / Trunk Hood, Rear Gate - Dent - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratches on tail light</p>