

General Information

Date & Time: 19, Feb, 2026 10:41

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	15,900
Registration No.	NKS4910	Chassis No.	PAHACACA3S6424705
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



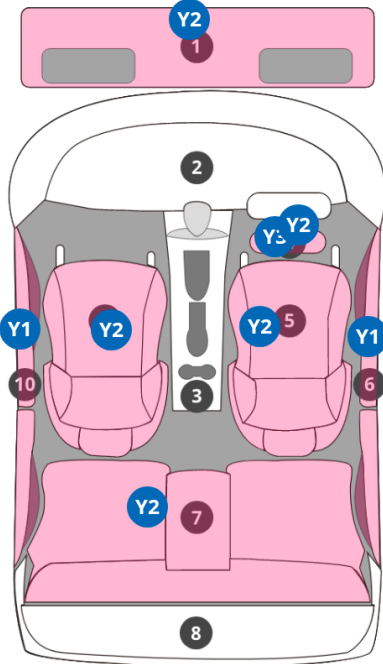
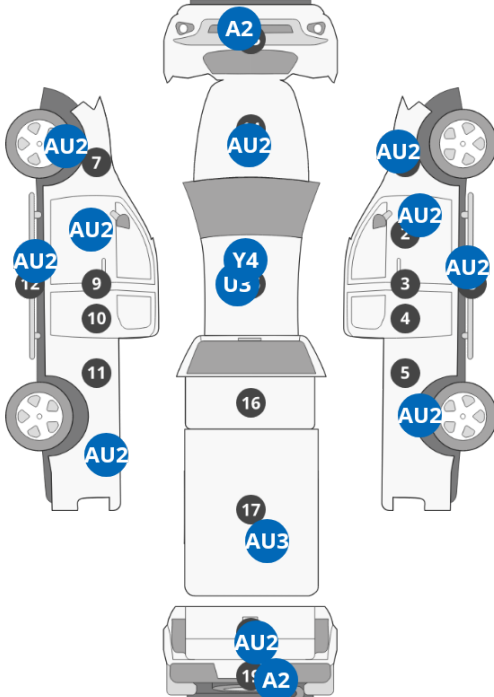
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.6	103	102	106
2	Boot Lid	58.6	64	53	59
3	Roof	109.0	120	112	103/101
4	Left Front Fender	101.5	101	109	95
5	Left Front Door	98.0	101	100	93
6	Center Panel Left	73.7	75	67	79
7	Left Rear Door				
8	Left Back Panel	62.5	65	61	62
9	Right Front Fender	104.6	100	110	104
10	Right Front Door	97.9	96	93	105
11	Center Panel Right	112.6	119	121	98
12	Right Rear Door				
13	Right Back Panel	68.7	66	70	71

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / Rear Seat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Small</p>	<p>Remarks (L) Front Door, Molding - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / Roof - Dent - Medium / Cargo Bed Floor - Scratch & Dent - Medium / (L) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Side Gate - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Front Windshield - Damaged - Large</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>No LTO plate, with spare tire, with spare key, with jack, no tools, with manual and warranty booklet, scratches on taillight and headlight, issue on windshield.</p>