

General Information

Date & Time: 19, Feb, 2026 15:41

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	36,137
Registration No.	NEY1780	Chassis No.	PA1B18F34P4216351
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



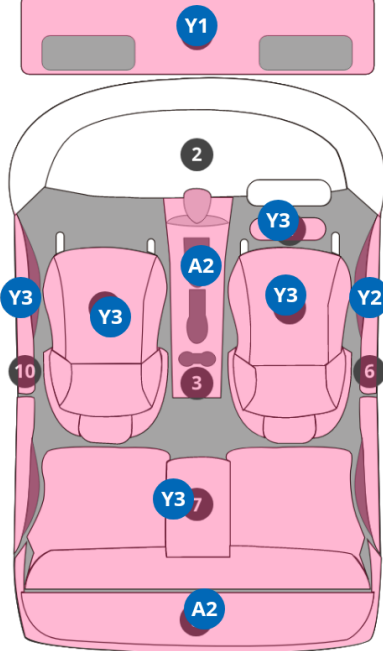
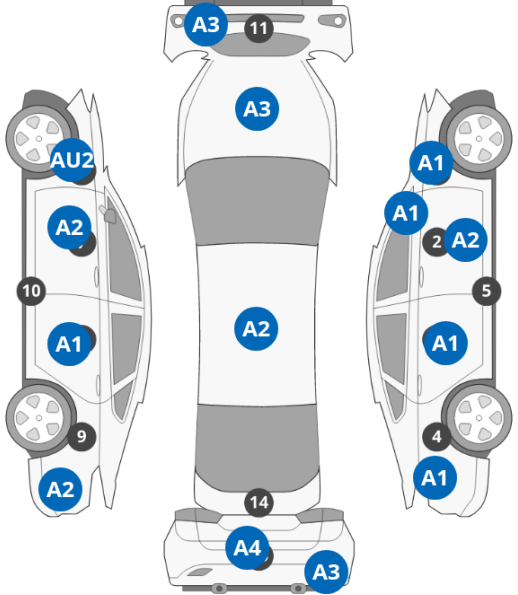
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.3	95	90	101
2	Boot Lid	139.3	123	146	149
3	Roof	85.1	81	80	90/90
4	Left Front Fender	101.0	98	101	104
5	Left Front Door	100.6	100	100	102
6	Center Panel Left				
7	Left Rear Door	108.0	116	105	103
8	Left Back Panel	110.6	111	103	118
9	Right Front Fender	102.5	109	99	100
10	Right Front Door	105.3	107	104	105
11	Center Panel Right				
12	Right Rear Door	105.2	98	101	117
13	Right Back Panel	103.9	100	101	111

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Medium / Trunk Room - Worn, Scratch, Cut, Crack - Small / (L) Front Trim - Grime - Medium / (L) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / Ceiling - Grime - Minimal / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small	Remarks Roof - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Minimal
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate/with spare tire / No spare key/with jack No tools/No reverse camera/No warranty booklet/No seat cover/