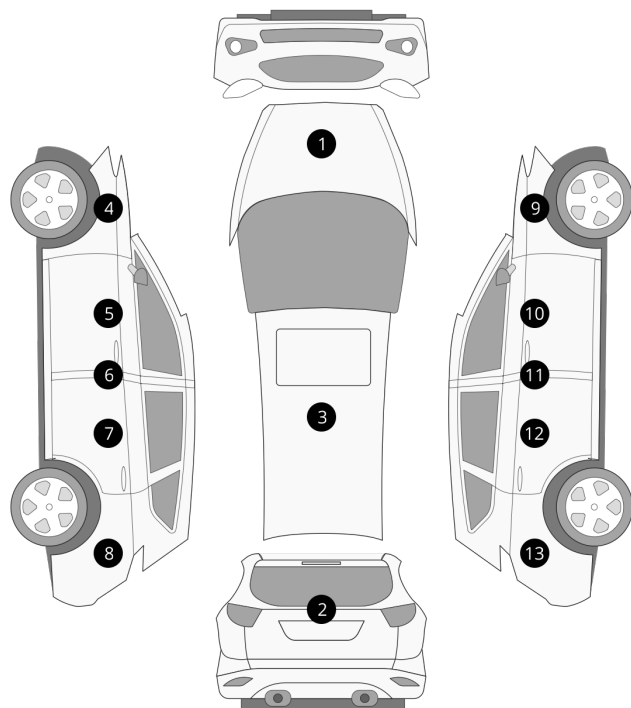


General Information

Date & Time: 04, Feb, 2025 09:32

Make	Toyota	Model	Vios
YOM	2021	Mileage	70,794
Registration No.	NHA3184	Chassis No.	PA1B18F35L4130699
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



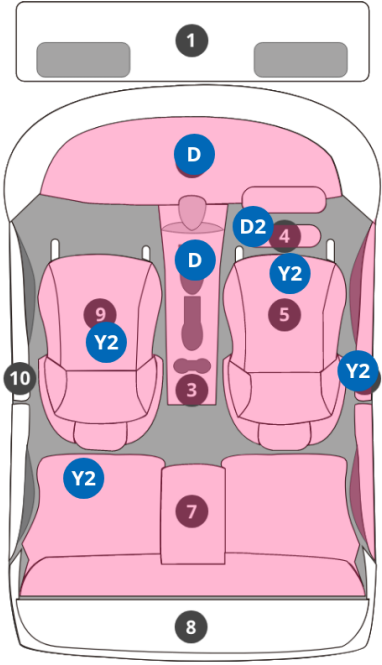
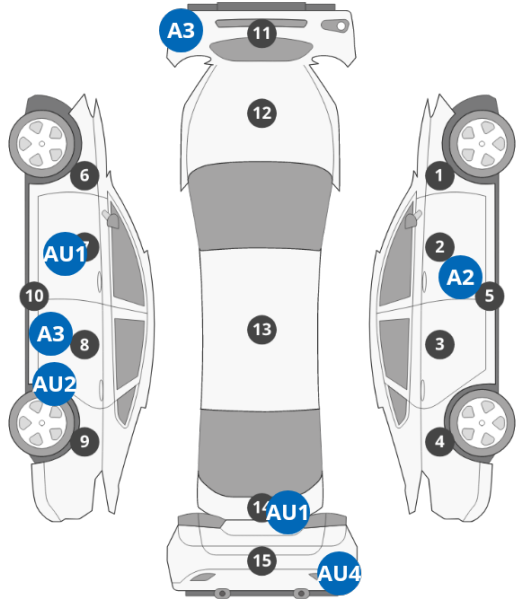
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	306.6	267	382	271
2	Boot Lid	96.4	99	97	93
3	Roof	237.7	259	241	207/244
4	Left Front Fender	81.0	82	81	80
5	Left Front Door	91.6	91	96	88
6	Center Panel Left				
7	Left Rear Door	86.2	91	85	82
8	Left Back Panel	182.0	178	190	178
9	Right Front Fender	86.8	84	89	87
10	Right Front Door	89.6	97	85	87
11	Center Panel Right				
12	Right Rear Door	90.0	90	86	94
13	Right Back Panel	102.0	102	100	104

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Small	Remarks Bonnet - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Spare Key - Issue - Unexist

Inspector Notes
without warranty booklet. with Spare tire,jack and tools. with LTO plate.