

General Information

Date & Time: 23, Feb, 2026 15:35

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	56,011
Registration No.	FAJ7794	Chassis No.	PA1B18F36N4179428
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



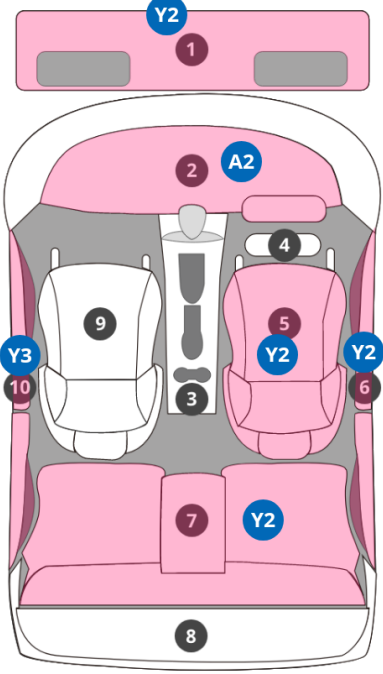
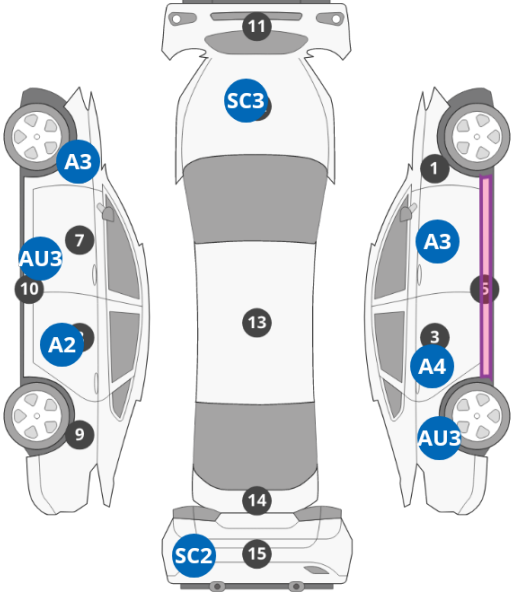
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.3	104	117	104
2	Boot Lid	94.7	99	89	96
3	Roof	80.6	74	87	78/84
4	Left Front Fender	84.0	86	80	86
5	Left Front Door	88.1	89	87	89
6	Center Panel Left				
7	Left Rear Door	85.7	87	86	84
8	Left Back Panel	84.7	89	82	83
9	Right Front Fender	90.3	90	85	96
10	Right Front Door	89.0	89	90	89
11	Center Panel Right				
12	Right Rear Door	93.7	96	94	91
13	Right Back Panel	96.4	90	97	102

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / (R) Front Seat - Grime - Small / Rear Seat - Grime - Small</p>	<p>Remarks (R) Step - Repair Traces - Yes / (R) Step - Replaced - Yes / (R) Front Door, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Rust, Corrosion - Small / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Rust, Corrosion - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes</p>

<p>Inspector Notes</p>
<p>no reverse camera. with spare tire. no jack and tools. with seat cover. with 2 spare key. no warranty booklet</p>