

General Information

Date & Time: 24, Feb, 2026 10:57

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	57,333
Registration No.	FAN9238	Chassis No.	PA1B18F35P4200319
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



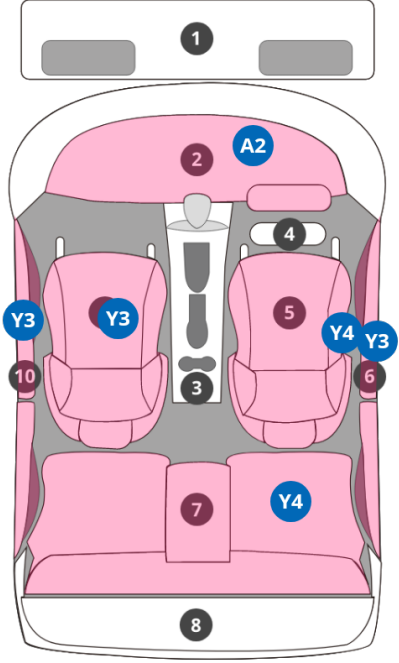
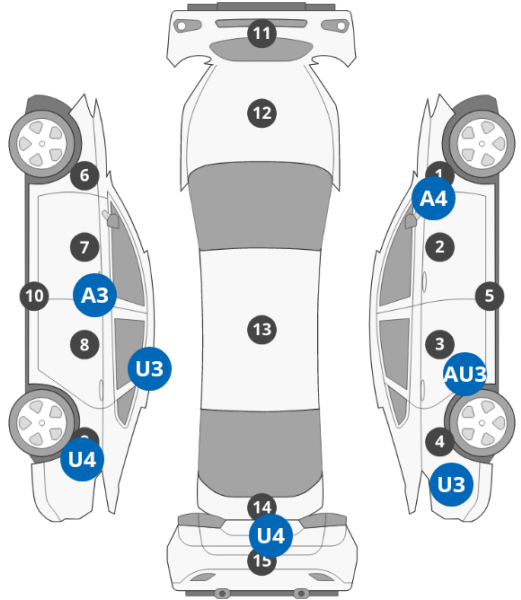
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	96.1	91	88	109
2	Boot Lid	99.0	101	96	100
3	Roof	89.7	97	85	92/86
4	Left Front Fender	71.6	76	69	70
5	Left Front Door	94.6	90	101	93
6	Center Panel Left				
7	Left Rear Door	92.8	97	89	93
8	Left Back Panel	102.5	104	107	97
9	Right Front Fender	93.1	95	93	91
10	Right Front Door	92.3	100	87	90
11	Center Panel Right				
12	Right Rear Door	90.3	82	84	105
13	Right Back Panel	93.6	87	88	106

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Trim - Grime - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Large / Dashboard - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Large</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / Trunk Hood, Rear Gate - Dent - Large / (L) Rear Fender, Molding - Dent - Large / (L) Rear Door, Molding - Dent - Medium / (R) Front Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium</p>
Frame Evaluation : A	Functional Evaluation : E
<p>Remarks Defects not found</p>	<p>Remarks Power Steering - Issue - Yes / Air Conditioner - Function - Weak / Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Spare Tire. no spare key. no seat cover. nowarranty booklet. no Jack and tools</p>