

General Information

Date & Time: 20, Feb, 2026 16:06

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	44,244
Registration No.	DAP2159	Chassis No.	PA1B18F30M41850485
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



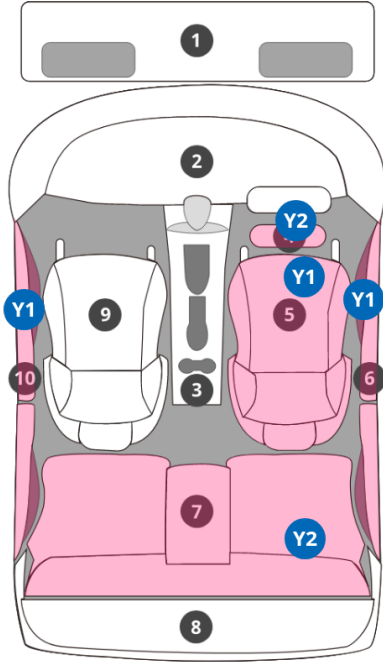
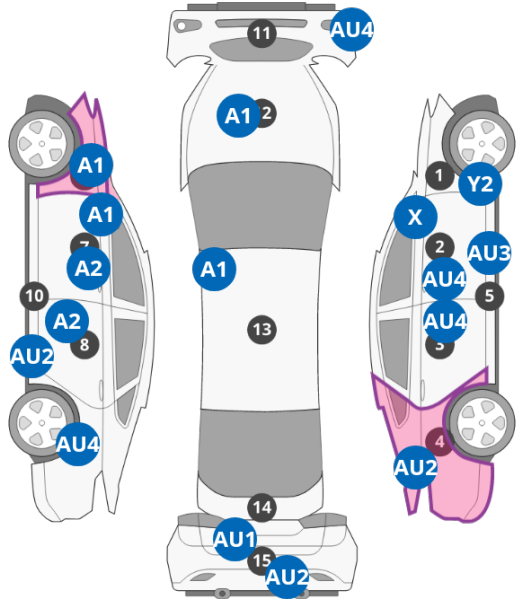
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.3	113	112	109
2	Boot Lid	112.3	123	100	114
3	Roof	93.6	102	88	86/99
4	Left Front Fender	169.6	152	184	173
5	Left Front Door	154.3	156	145	162
6	Center Panel Left				
7	Left Rear Door	92.8	91	88	100
8	Left Back Panel	106.3	112	107	100
9	Right Front Fender	167.6	184	168	151
10	Right Front Door	163.6	171	156	164
11	Center Panel Right				
12	Right Rear Door	167.3	174	149	179
13	Right Back Panel	176.0	173	156	199

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Trim - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small</p>	<p>Remarks (L) Front Fender - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Front Fender, Molding - Crack, Gap - Small / (R) Mirror - Stuck - Yes / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Rear Fender, Molding - Repair mark - Yes / (R) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Minimal</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>No Lto plate, with spare tire and jack, no warranty booklet and tools, scratches on headlights and taillights,</p>