

## General Information

Date & Time: 21, Feb, 2026 08:45

<b>Make</b>	Toyota	<b>Model</b>	Wigo
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	37,150
<b>Registration No.</b>	NEW3404	<b>Chassis No.</b>	MKA4DF5FMJ057399
<b>CC</b>	1.0	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Hatchback
<b>Colour</b>	Gray		

## Body / Panel Condition



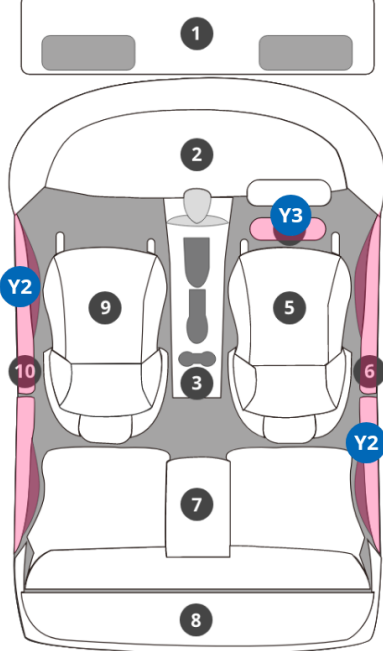
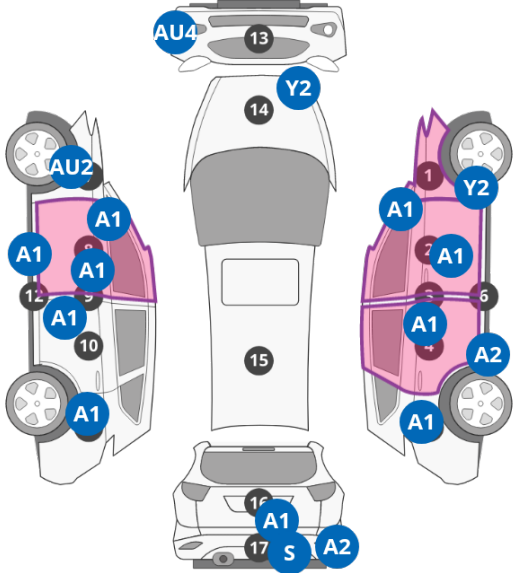
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.3	98	97	91
2	Boot Lid	91.2	83	96	96
3	Roof	86.2	73	92	94/85
4	Left Front Fender	156.3	195	134	140
5	Left Front Door	121.0	123	133	107
6	Center Panel Left				
7	Left Rear Door	89.5	84	92	93
8	Left Back Panel	105.8	96	108	114
9	Right Front Fender	193.0	198	185	196
10	Right Front Door	141.3	126	141	157
11	Center Panel Right				
12	Right Rear Door	135.3	142	133	131
13	Right Back Panel	139.0	141	136	140

Overall Evaluation :

**B**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">D</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (L) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / (R) Front Fender, Molding - Crack, Gap - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch &amp; Dent - Large / Bonnet, Headlight - Crack, Gap - Small / Muffler and Undercarriage Parts - Rust - Yes</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on taillight, crack headlight, muffler issue,</p>