

General Information

Date & Time: 24, Feb, 2026 15:24

Make	Toyota	Model	Fortuner
YOM	2024	Odo Meter Reading	40,273
Registration No.	GBC2516	Chassis No.	MHFBA3FS7P1053304
CC	2.8	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	White		

Body / Panel Condition



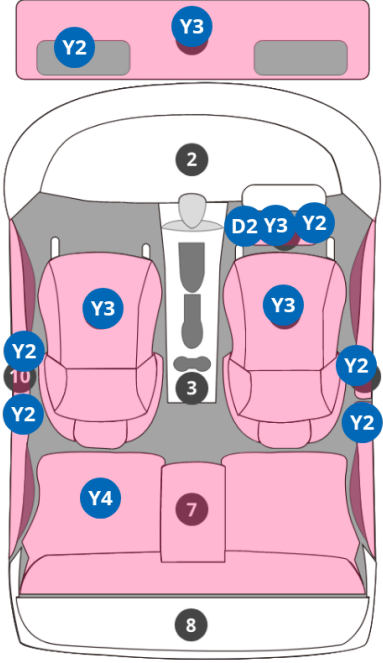
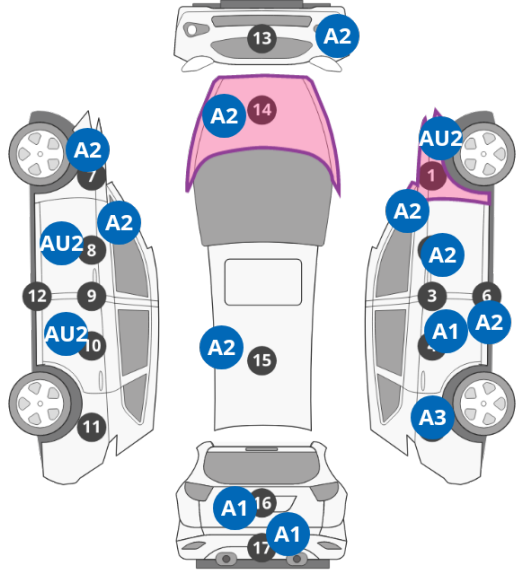
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	204.0	195	194	223
2	Boot Lid	122.6	114	141	113
3	Roof	184.0	186	209	178/163
4	Left Front Fender	125.0	117	124	134
5	Left Front Door	132.6	136	133	129
6	Center Panel Left				
7	Left Rear Door	128.0	131	122	131
8	Left Back Panel	132.0	138	129	129
9	Right Front Fender	173.0	168	176	175
10	Right Front Door	126.6	130	125	125
11	Center Panel Right				
12	Right Rear Door	121.0	115	120	128
13	Right Back Panel	131.3	130	122	142

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Grime - Medium / Ceiling - Grime - Medium / Rear Seat - Grime - Large / (L) Rear Trim - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Seat - Grime - Medium / Sunvisor, Sunglass Holder - Grime - Small</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / Trunk Hood, Rear Gate - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Mirror - Scratch - Small / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Small / Bonnet, Headlight - Repair mark - Yes / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch - Small</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>	
<p>Gap at front bumper. Unusual sound when opening of upper glove box. Scratches on taillight. With warranty booklet, spare tire, tools and jack. 1 key. With LTO plate.</p>	