

General Information

Date & Time: 24, Feb, 2026 18:06

Make	Toyota	Model	Vios
YOM	2026	Odo Meter Reading	8,669
Registration No.	GBK8194	Chassis No.	PA1B18F32S4294927
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



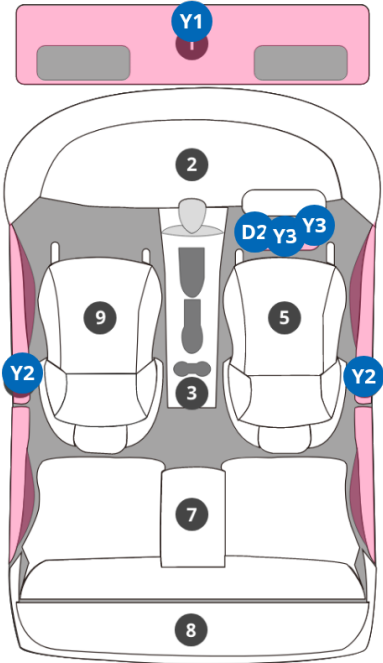
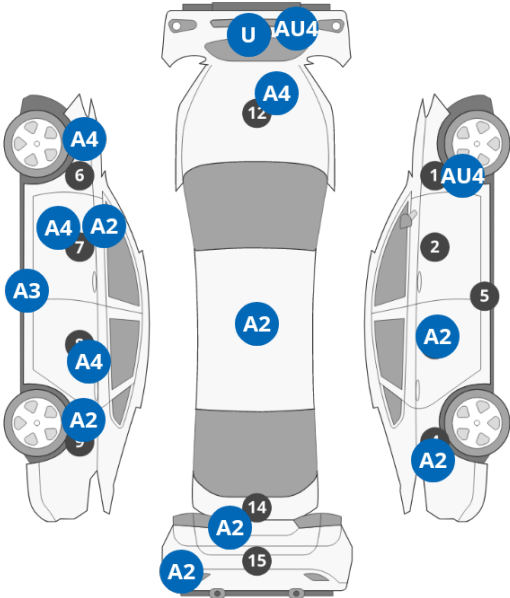
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	112	118	123
2	Boot Lid	169.3	156	172	180
3	Roof	101.2	111	98	94/102
4	Left Front Fender	102.6	104	100	104
5	Left Front Door	109.3	116	106	106
6	Center Panel Left				
7	Left Rear Door	111.6	119	107	109
8	Left Back Panel	111.0	118	111	104
9	Right Front Fender	100.7	102	99	101
10	Right Front Door	110.3	110	112	109
11	Center Panel Right				
12	Right Rear Door	110.0	107	109	114
13	Right Back Panel	110.0	109	104	117

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Minimal / Mat Other - Grime - Medium / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Large / (L) Rear Door, Molding - Scratch - Large / (L) Rear Fender, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Medium / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Member (Bolted) - Dent - Yes / Bonnet, Headlight - Scratch - Large / Roof - Scratch - Small</p>
Frame Evaluation : D	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Turn Signal, Hazard Flasher - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO apprehension. Possible flooding. Gap at front bumper, Front fenders and bonnet. Scratches at headlight and taillight. With warranty booklet, spare tire, and seat cover. Incomplete tools. Without jack. 1 key. With LTO plate.</p>