

General Information

Date & Time: 01, Feb, 2025 15:45

Make	Toyota	Model	Vios
YOM	2022	Mileage	55,555
Registration No.	NFJ5029	Chassis No.	PA1B18F31N4171141
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



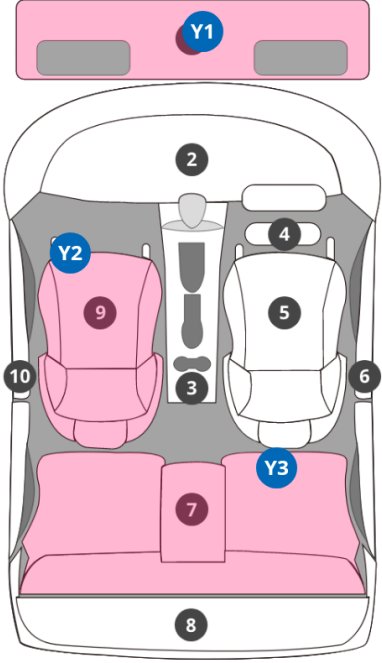
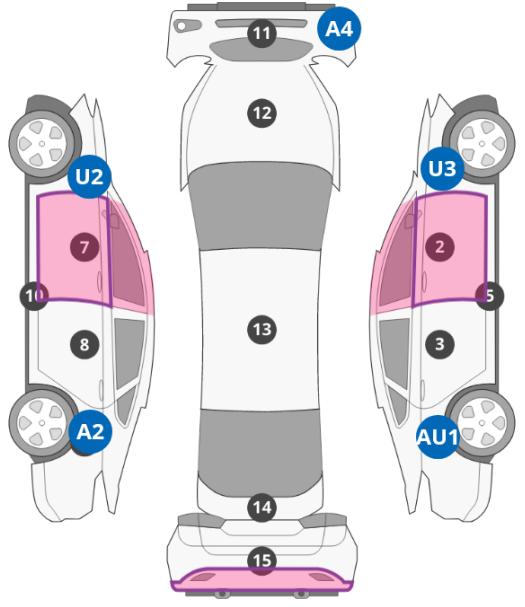
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	107.0	105	102	114
2	Boot Lid	102.7	98	103	107
3	Roof	96.4	104	89	89/103
4	Left Front Fender	93.0	96	95	89
5	Left Front Door	97.3	97	98	97
6	Center Panel Left				
7	Left Rear Door	99.1	100	99	99
8	Left Back Panel	106.3	107	108	104
9	Right Front Fender	85.2	83	89	84
10	Right Front Door	95.0	97	96	92
11	Center Panel Right				
12	Right Rear Door	94.8	92	90	102
13	Right Back Panel	94.1	98	91	94

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks Ceiling - Grime - Minimal / Rear Seat - Grime - Medium / (L) Front Seat - Grime - Small	Remarks Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Repair mark - Yes / (L) Front Fender, Molding - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Large / (R) Front Fender, Molding - Dent - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes

Inspector Notes
without warranty booklet. with Spare Tire, jack, and tools. without LTO plate.