

General Information

Date & Time: 23, Feb, 2026 16:01

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	82,748
Registration No.	CBE9907	Chassis No.	PA1B18F35N4195913
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



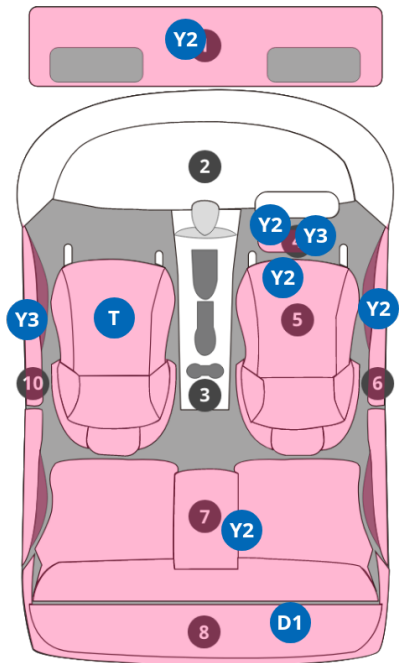
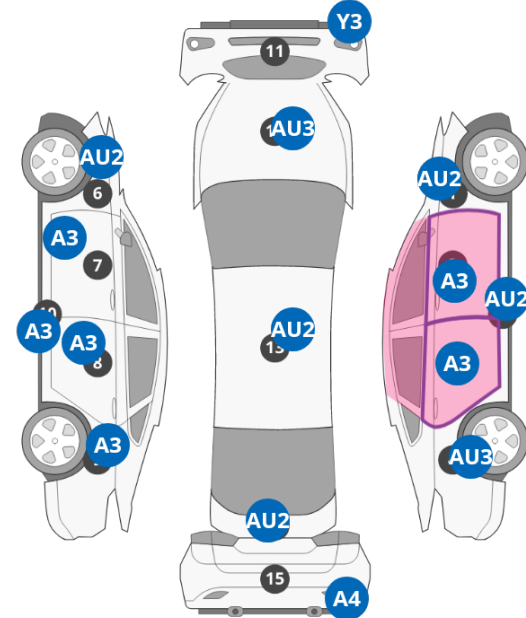
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	105.0	109	93	113
2	Boot Lid	114.6	111	110	123
3	Roof	102.1	113	98	99/98
4	Left Front Fender	99.3	102	100	96
5	Left Front Door	110.6	101	111	120
6	Center Panel Left				
7	Left Rear Door	108.0	117	104	103
8	Left Back Panel	112.0	118	109	109
9	Right Front Fender	127.3	129	135	118
10	Right Front Door	247.3	128	487	127
11	Center Panel Right				
12	Right Rear Door	115.3	109	110	127
13	Right Back Panel	103.4	100	98	112

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Cigarette Burns - Burnt, Hole / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / (R) Front Trim - Grime - Small / Ceiling - Grime - Small / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Repair mark - Yes / (R) Front Door, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Medium / (L) Step, In-panel, Side Spoiler - Scratch - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Medium / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with inc tools and jack, with spare tire, no spare key, no warranty and manual booklet, scratches on taillight and headlight, issue on plate light.</p>