

General Information

Date & Time: 23, Feb, 2026 12:53

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	14,719
Registration No.	NJA7899	Chassis No.	PA1B18F30S4285742
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



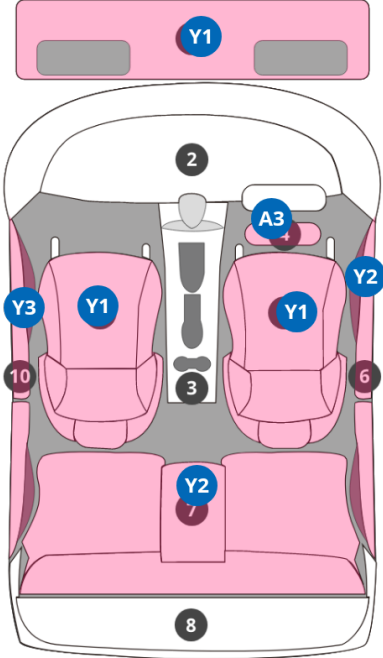
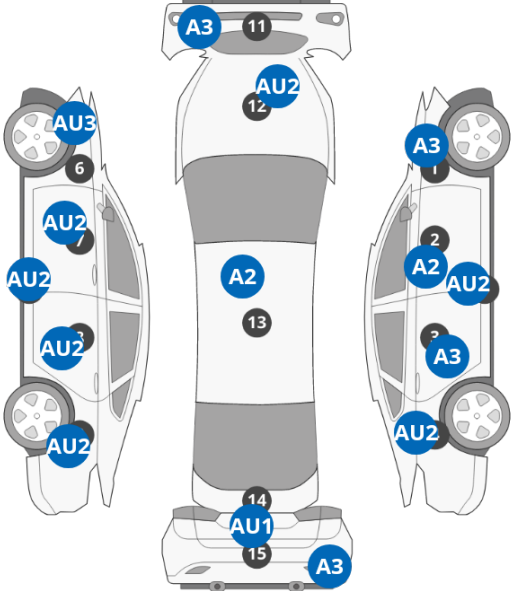
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.0	109	101	123
2	Boot Lid	111.6	118	101	116
3	Roof	93.6	97	95	90/93
4	Left Front Fender	101.8	107	99	99
5	Left Front Door	100.0	95	103	102
6	Center Panel Left				
7	Left Rear Door	104.3	105	103	105
8	Left Back Panel	110.6	114	105	113
9	Right Front Fender	103.9	107	100	105
10	Right Front Door	100.4	102	100	99
11	Center Panel Right				
12	Right Rear Door	102.5	107	101	100
13	Right Back Panel	104.3	108	102	103

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Grime - Minimal / (R) Front Seat - Grime - Minimal / Rear Seat - Grime - Small / Ceiling - Grime - Minimal</p>	<p>Remarks Roof - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Medium / Bonnet, Headlight - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with warranty booklet, with reverse camera, with jack, no tools, scratches on taillight and headlight, no spare tire and key.</p>