

General Information

Date & Time: 23, Feb, 2026 15:59

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	31,371
Registration No.	DBN4616	Chassis No.	PA1B18F31P4232376
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Green		

Body / Panel Condition



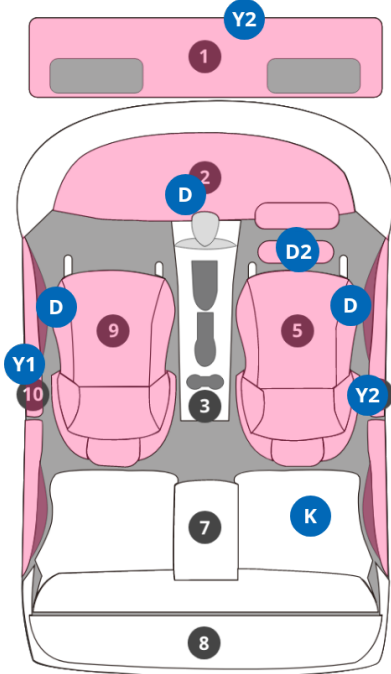
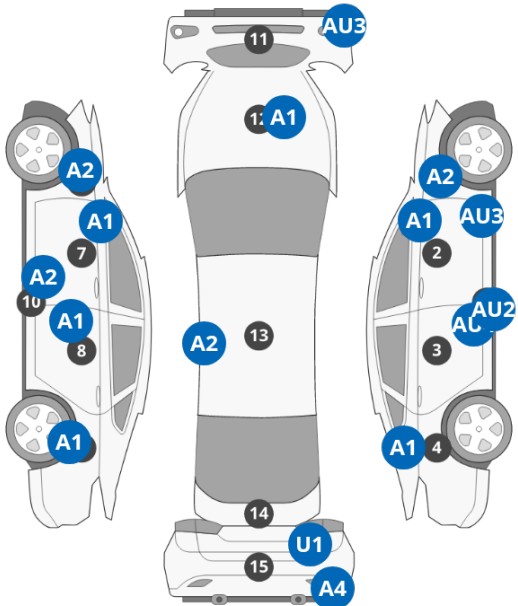
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	114	104	113
2	Boot Lid	103.4	99	101	110
3	Roof	95.8	106	95	87/95
4	Left Front Fender	97.7	94	101	98
5	Left Front Door	103.5	103	109	99
6	Center Panel Left				
7	Left Rear Door	100.5	99	103	99
8	Left Back Panel	107.6	113	102	108
9	Right Front Fender	104.6	107	102	105
10	Right Front Door	105.1	107	99	109
11	Center Panel Right				
12	Right Rear Door	104.4	112	99	102
13	Right Back Panel	100.8	100	98	104

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Overall Interior - Animal Hair - Yes / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Minimal / (R) Front Floor Mat - Worked - Small / (L) Front Floor Mat - Worked - Small / (R) Front Seat - Worn - Yes / (L) Front Seat - Worn - Yes</p>	<p>Remarks (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / Bonnet, Headlight - Scratch - Minimal / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet, jack and tools, with spare tire, with LTO plate, scratches on tail light, possible flooding</p>