

General Information

Date & Time: 23, Feb, 2026 17:44

Make	Toyota	Model	Rush
YOM	2019	Odo Meter Reading	78,849
Registration No.	NDO9387	Chassis No.	MHKE8FF3PKK008116
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red		

Body / Panel Condition



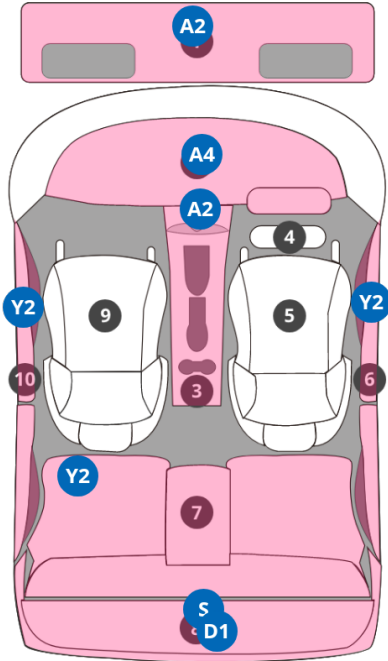
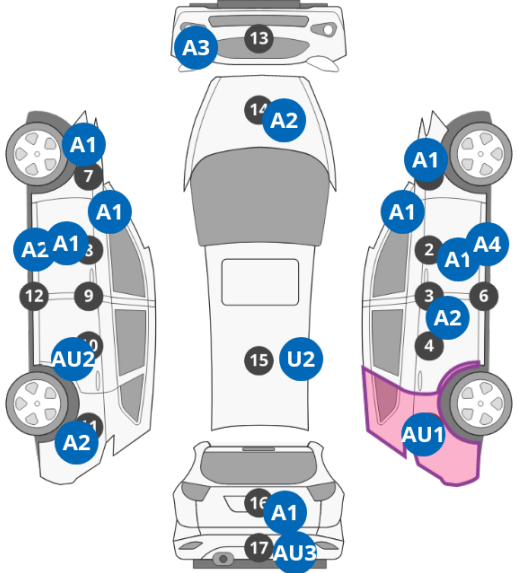
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	152.6	151	162	145
2	Boot Lid	843.0	939	859	731
3	Roof	153.0	144	148	167/153
4	Left Front Fender	167.3	165	160	177
5	Left Front Door	177.3	180	165	187
6	Center Panel Left				
7	Left Rear Door	188.0	227	168	169
8	Left Back Panel	182.6	207	164	177
9	Right Front Fender	131.6	121	123	151
10	Right Front Door	119.3	109	107	142
11	Center Panel Right				
12	Right Rear Door	161.3	173	176	135
13	Right Back Panel	295.3	550	187	149

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Cut, Crack - Small / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Steering Wheel - Worn, Peel, Crack - Large / Knobs - Worn, Peel, Crack - Small / Overall Interior - Smell - Yes / Rear Seat - Grime - Small / Trunk Room - Worked - Minimal</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Large / (R) Rear Door, Molding - Scratch - Small / Overall Exterior - Full Re-Paint in same color - Yes / (R) Rear Fender, Molding - Repair mark - Difference in Color / Roof - Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Front Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, foul smell</p>