

General Information

Date & Time: 23, Feb, 2026 10:12

Make	Mitsubishi	Model	Montero SPT
YOM	2017	Odo Meter Reading	75,365
Registration No.	NCN6540	Chassis No.	MMBGUKR13P00626326
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



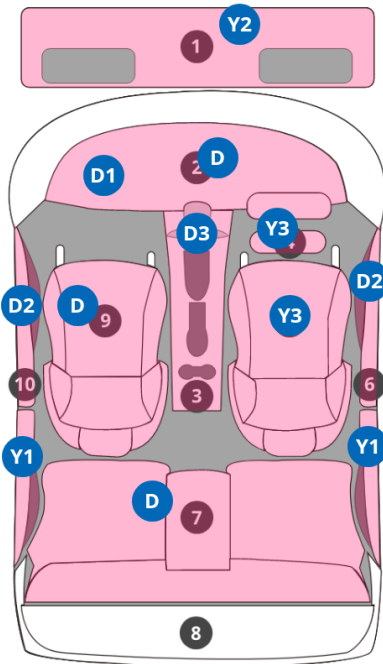
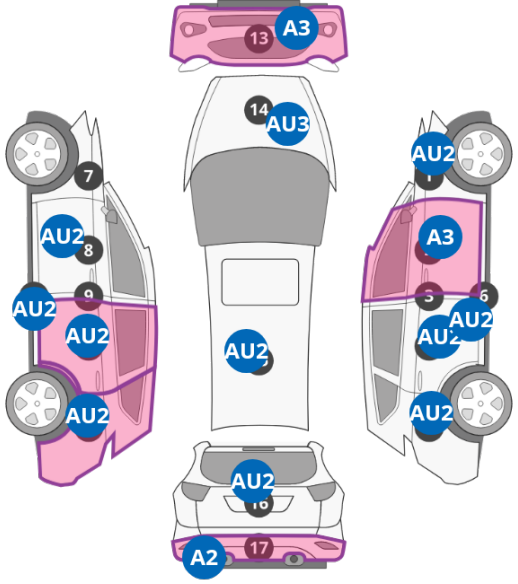
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	154.0	175	156	131
2	Boot Lid	99.4	93	105	100
3	Roof	104.5	106	102	101/109
4	Left Front Fender	141.0	139	155	129
5	Left Front Door	173.6	186	160	175
6	Center Panel Left				
7	Left Rear Door	177.6	184	166	183
8	Left Back Panel	518.3	147	861	547
9	Right Front Fender	171.0	110	201	202
10	Right Front Door	207.0	194	238	189
11	Center Panel Right				
12	Right Rear Door	192.6	264	162	152
13	Right Back Panel	399.3	809	214	175

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Grime - Medium / (L) Front Trim - Worked - Small / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Console, Switches, Vents - Loose, Deformed - Medium / Ceiling - Grime - Small / Rear Seat - Worn - Yes / (R) Front Trim - Worked - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal / Dashboard - Worked - Minimal / Instrument Panel - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / Overall Exterior - Full Re-Paint in same color - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch - Medium / (R) Front Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch & Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : C	Functional Evaluation : C
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTOplate, with spare tire, no manual and warranty booklet, no spare key, scratches on taillight and headlight, issue on headlight, unusual sound in engine bay ,Check engine indicator lamp.</p>