

General Information

Date & Time: 23, Feb, 2026 12:51

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	171,596
Registration No.	NGP9560	Chassis No.	PA1B18F35L4128239
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



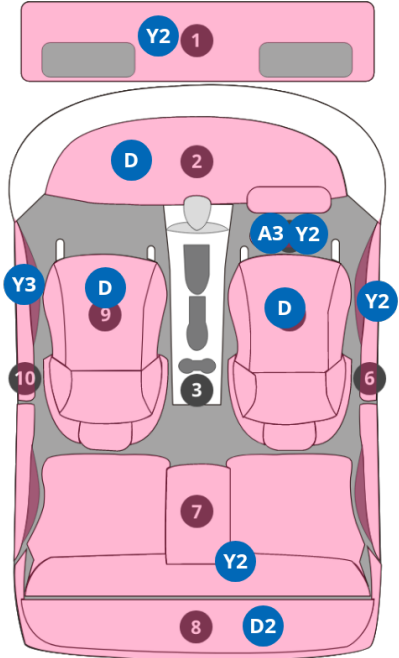
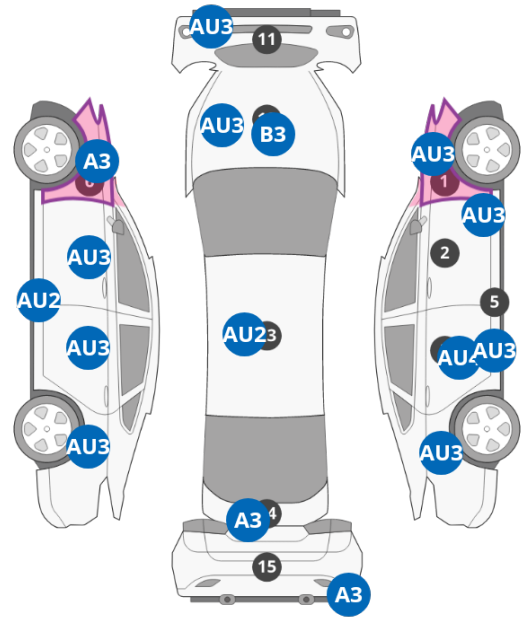
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	95.3	99	82	105
2	Boot Lid	101.9	102	93	111
3	Roof	92.1	95	84	89/101
4	Left Front Fender	148.6	124	210	112
5	Left Front Door	115.5	126	126	95
6	Center Panel Left				
7	Left Rear Door	114.9	140	90	115
8	Left Back Panel	115.0	122	119	104
9	Right Front Fender	125.3	142	116	118
10	Right Front Door	133.0	136	122	141
11	Center Panel Right				
12	Right Rear Door	113.7	128	117	96
13	Right Back Panel	113.6	115	112	114

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Cut, Crack - Medium / (L) Front Trim - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Worn - Yes / (R) Front Floor Mat - Grime - Small / Rear Seat - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / (R) Front Trim - Grime - Small / Trunk Room - Loose, Deformed - Small	Remarks (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Fender, Molding - Repair mark - Yes / Roof - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Bonnet, Headlight - Modified - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Medium
Frame Evaluation : C	Functional Evaluation : B
Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
with LTO plate, with jack, with manual and warranty booklet, issue on trunk latch, issue on hood stand, no spare tire and key, scratches on taillight and headlight, aircon issue,