

General Information

Date & Time: 21, Feb, 2026 13:23

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	21,043
Registration No.	NKT8037	Chassis No.	PAHACACA3S6424154
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Utility Passenger
Colour	White		

Body / Panel Condition



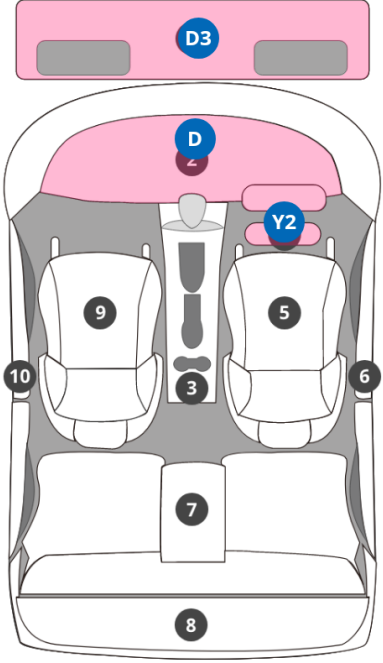
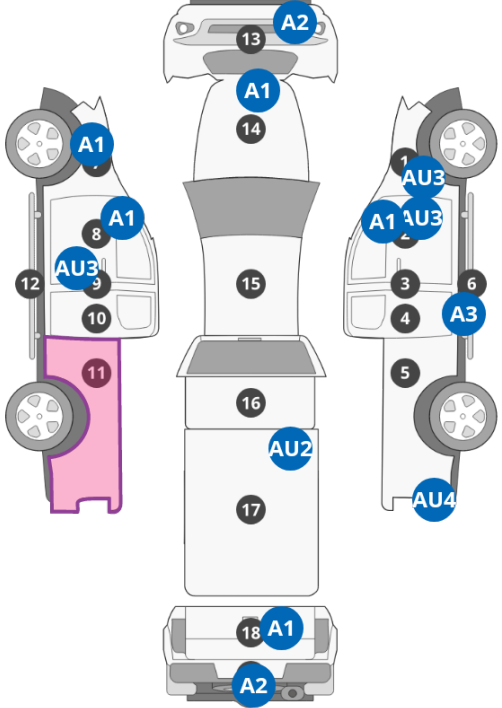
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	98.6	104	92	100
2	Boot Lid	53.6	60	47	54
3	Roof	109.7	123	113	100/103
4	Left Front Fender	103.6	99	102	110
5	Left Front Door	99.3	96	104	98
6	Center Panel Left	91.5	104	88	83
7	Left Rear Door				
8	Left Back Panel	69.7	53	94	63
9	Right Front Fender	96.1	100	99	89
10	Right Front Door	98.1	96	101	97
11	Center Panel Right	97.8	114	91	89
12	Right Rear Door				
13	Right Back Panel	73.3	65	83	72

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Loose, Deformed - Medium / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Floor Mat - Grime - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Side Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / Roof - Scratch & Dent - Small / Rear Gate - Scratch - Minimal / (L) Side Gate - Partially Missing - Yes / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / (L) Mirror - Scratch - Minimal / (R) Mirror - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With Lto plate, with warranty booklet, with spare tire and jack, 1key, no tools, scratches on headlights and taillights</p>