

General Information

Date & Time: 21, Feb, 2026 18:03

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	10,478
Registration No.	NKN6539	Chassis No.	MR0JB8DD0R3236106
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Black		

Body / Panel Condition



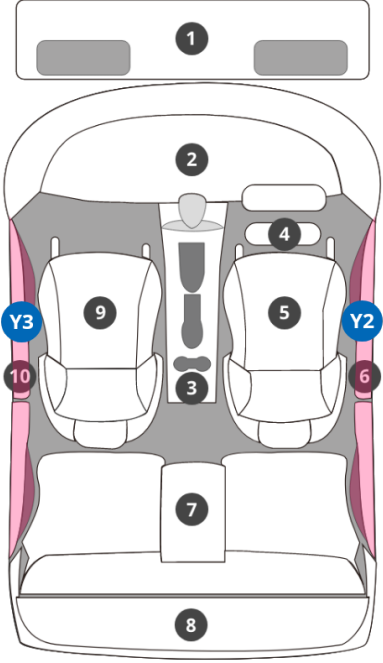
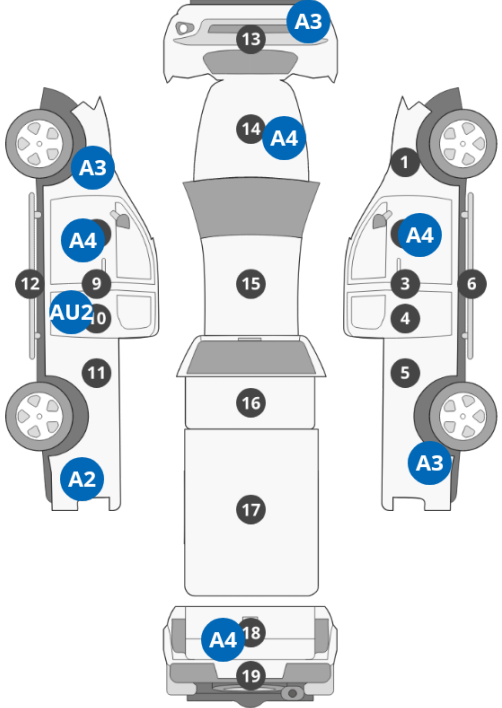
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	121.3	119	121	124
2	Boot Lid	102.2	96	113	98
3	Roof	118.2	123	109	130/111
4	Left Front Fender	123.3	119	128	123
5	Left Front Door	113.3	119	109	112
6	Center Panel Left				
7	Left Rear Door	108.3	112	109	104
8	Left Back Panel	135.3	133	142	131
9	Right Front Fender	126.3	127	120	132
10	Right Front Door	111.6	113	111	111
11	Center Panel Right				
12	Right Rear Door	111.6	104	111	120
13	Right Back Panel	111.3	106	115	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	B	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium</p>		<p>Remarks Bonnet, Headlight - Scratch - Large / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Side Gate - Scratch - Medium / Rear Gate - Scratch - Large / (L) Side Gate - Scratch - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Front Door, Molding - Scratch - Large / (L) Front Fender, Molding - Scratch - Medium</p>	
Frame Evaluation :	A	Functional Evaluation :	A
<p>Remarks Defects not found</p>		<p>Remarks Defects not found</p>	

Inspector Notes

no jack and tools/ with spare tire and LTO plate/ with warranty booklet