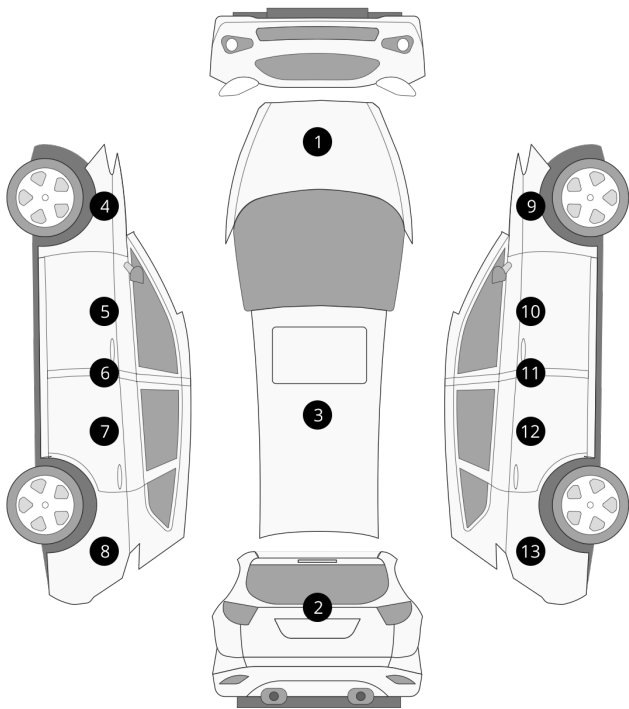


General Information

Date & Time: 21, Feb, 2026 19:40

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	33,123
Registration No.	NHI9365	Chassis No.	PA1B18F33P4209522
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



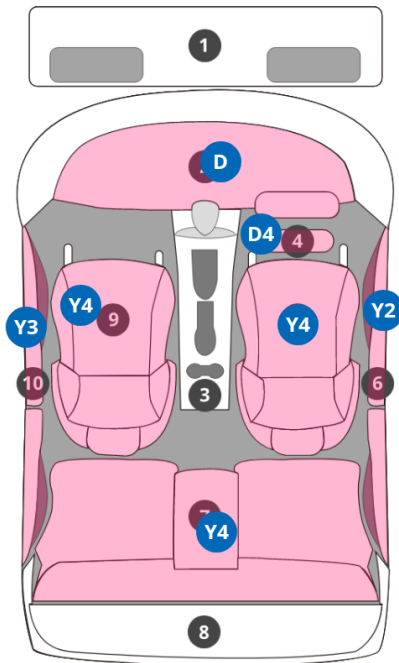
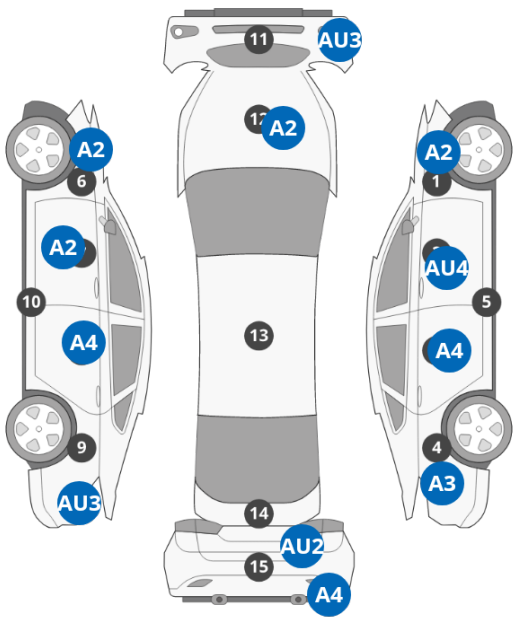
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	99.0	94	109	94
2	Boot Lid	114.0	110	113	119
3	Roof	89.0	89	87	82/99
4	Left Front Fender	93.9	106	88	88
5	Left Front Door	91.2	89	94	91
6	Center Panel Left				
7	Left Rear Door	95.0	91	98	96
8	Left Back Panel	106.3	109	102	108
9	Right Front Fender	92.8	90	95	93
10	Right Front Door	95.3	91	95	100
11	Center Panel Right				
12	Right Rear Door	105.3	108	102	106
13	Right Back Panel	99.4	95	97	106

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes</p>	<p>Remarks Front Bumper, Grille, Lamps - Scratch & Dent - Medium / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch & Dent - Small / (L) Rear Fender, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet/ incomplete tools/ with jack and spare tire/with LTO plate/</p>