

General Information

Date & Time: 24, Feb, 2026 14:00

Make	Toyota	Model	Rush
YOM	2023	Odo Meter Reading	57,194
Registration No.	EAF5114	Chassis No.	MHKE8FF3PNK047946
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



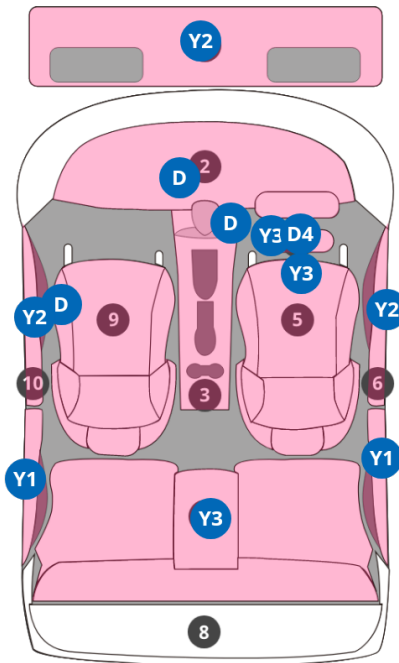
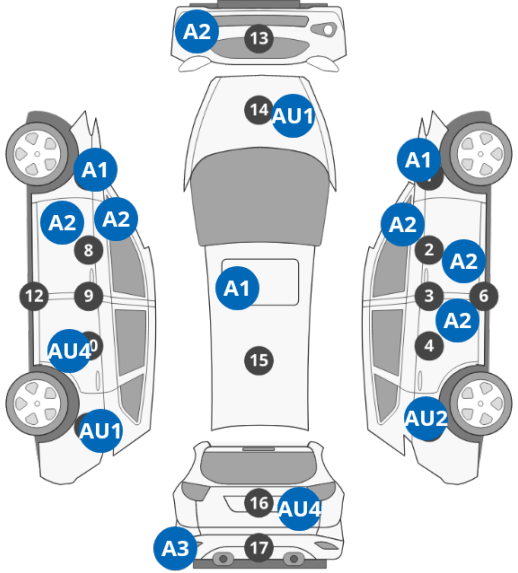
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.1	109	98	102
2	Boot Lid	187.6	230	184	149
3	Roof	132.8	98	89	110/235
4	Left Front Fender	108.6	108	108	110
5	Left Front Door	116.6	126	114	110
6	Center Panel Left				
7	Left Rear Door	113.3	119	114	107
8	Left Back Panel	110.0	113	111	106
9	Right Front Fender	114.6	113	117	114
10	Right Front Door	119.3	111	133	114
11	Center Panel Right				
12	Right Rear Door	112.6	110	115	113
13	Right Back Panel	107.6	111	109	103

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Medium / (L) Front Seat - Worn - Yes / (R) Front Seat - Grime - Medium / Mat Other - Grime - Medium / Mat Other - Worked - Large / (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / (R) Rear Trim - Grime - Minimal / (L) Rear Trim - Grime - Minimal</p>	<p>Remarks Trunk Hood, Rear Gate - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch & Dent - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with warranty booklet and jack, no tools, with spare tire, with LTO plate, scratches on tail light</p>