

## General Information

Date & Time: 24, Feb, 2026 16:30

<b>Make</b>	Toyota	<b>Model</b>	Innova
<b>YOM</b>	2023	<b>Odo Meter Reading</b>	146,945
<b>Registration No.</b>	NHI6047	<b>Chassis No.</b>	PA2CA8EM1P0119089
<b>CC</b>	2.8	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Wagon
<b>Colour</b>	Silver		

## Body / Panel Condition



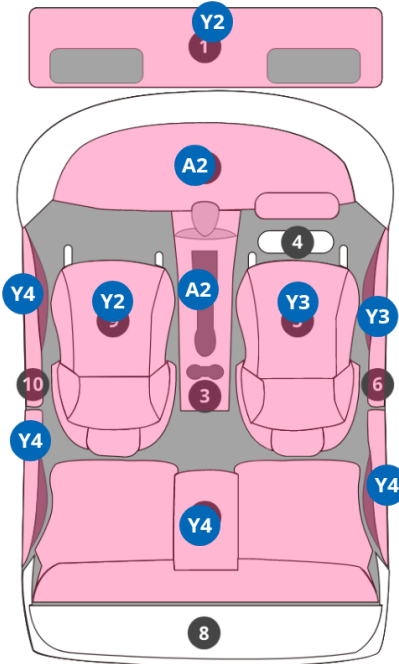
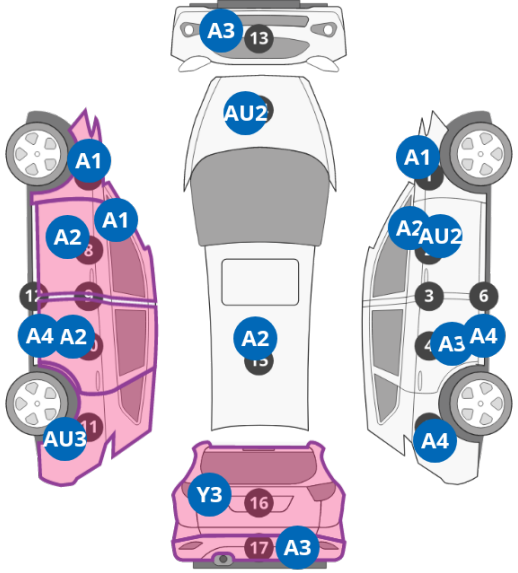
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	103.2	84	109	117
2	Boot Lid	571.3	492	982	240
3	Roof	95.4	101	85	106/89
4	Left Front Fender	353.6	798	137	126
5	Left Front Door	122.0	108	119	139
6	Center Panel Left				
7	Left Rear Door	333.4	775	127	98
8	Left Back Panel	103.6	102	108	101
9	Right Front Fender	101.0	100	106	97
10	Right Front Door	101.6	105	100	100
11	Center Panel Right				
12	Right Rear Door	105.6	93	108	116
13	Right Back Panel	98.7	101	96	99

## Overall Evaluation :

**D**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right;"><b>E</b></span>	<b>Exterior Evaluation :</b> <span style="float: right;"><b>E</b></span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Medium / Rear Seat - Grime - Large / (R) Rear Trim - Grime - Large / (L) Rear Trim - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Small / Dashboard - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Console, Switchs, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p><b>Remarks</b> (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Repair Traces - Yes / (R) Rear Fender - Repair Traces - Yes / (R) Rear Door - Repair Traces - Yes / Roof - Repair Traces - Yes / (L) Rear Fender, Molding - Repair mark - Yes / Trunk Hood, Rear Gate - Repair mark - Yes / Rear Bumper, Lamps, Panels - Repair mark - Yes / (R) Rear Fender, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch &amp; Dent - Small / Trunk Hood, Rear Gate - Crack, Gap - Medium / (L) Rear Fender, Molding - Scratch &amp; Dent - Medium / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Step, In-panel, Side Spoiler - Scratch - Large / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Repair mark - Yes / Bonnet, Headlight - Scratch &amp; Dent - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / Roof - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Large</p>
<b>Frame Evaluation :</b> <span style="float: right;"><b>A</b></span>	<b>Functional Evaluation :</b> <span style="float: right;"><b>B</b></span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>with LTO plate/with spare tire/No spare key/with jack and tools/right side tali light cover crack/reverse camera not working/No warranty booklet/No fog light/engine noise vibration</p>