

General Information

Date & Time: 23, Feb, 2026 13:51

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,104
Registration No.	NHS9463	Chassis No.	PA1B18F39R4272272
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



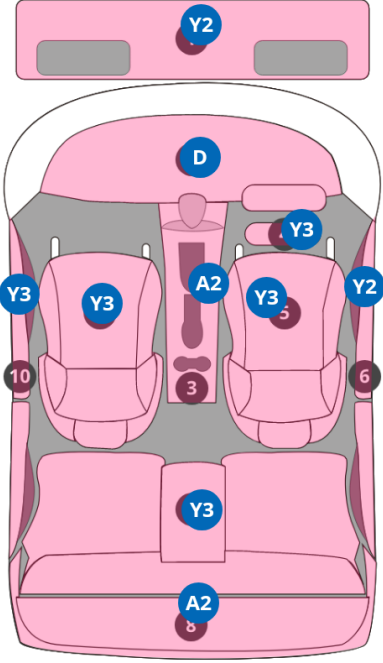
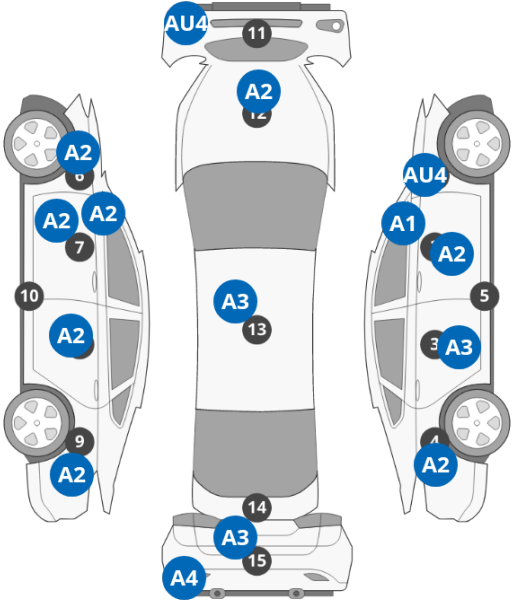
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	108.6	109	106	111
2	Boot Lid	104.9	103	100	112
3	Roof	98.8	104	100	90/102
4	Left Front Fender	96.3	95	96	98
5	Left Front Door	101.6	100	98	107
6	Center Panel Left				
7	Left Rear Door	106.3	112	106	101
8	Left Back Panel	117.3	133	116	103
9	Right Front Fender	105.6	110	106	101
10	Right Front Door	101.3	98	105	101
11	Center Panel Right				
12	Right Rear Door	104.0	109	102	101
13	Right Back Panel	110.6	107	107	118

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
	
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Trunk Room - Worn, Scratch, Cut, Crack - Small / Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks (R) Front Fender, Molding - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Large / Trunk Hood, Rear Gate - Scratch - Medium / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / Roof - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes</p>

Inspector Notes
<p>with LTO plate/with spare tire/with 1 spare key/No seat cover/with jack and incomplete tools/with reverse camera/No warranty booklet</p>