

General Information

Date & Time: 05, Feb, 2025 09:32

Make	Toyota	Model	Wigo
YOM	2023	Mileage	58,417
Registration No.	BAC8586	Chassis No.	MHKA4DF5FNJ074795
CC	1.0	Transmission	A/T
Fuel Type	Gas	Type of Body	Hatchback
Colour	Silver		

Body / Panel Condition



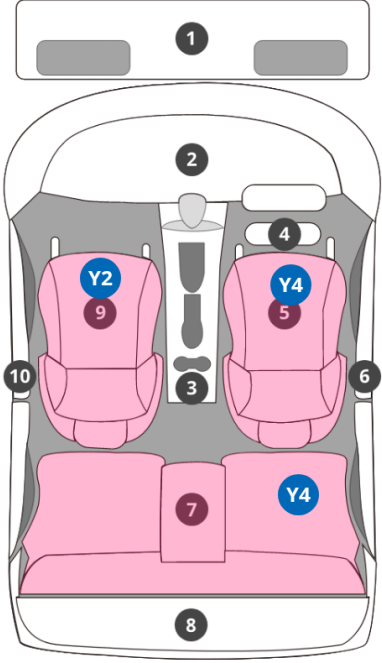
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	101.1	107	101	95
2	Boot Lid	109.6	102	110	117
3	Roof	91.0	83	91	98/92
4	Left Front Fender	95.8	93	98	98
5	Left Front Door	96.4	95	98	96
6	Center Panel Left				
7	Left Rear Door	95.5	95	96	95
8	Left Back Panel	171.3	172	167	175
9	Right Front Fender	97.5	109	96	87
10	Right Front Door	94.3	90	95	98
11	Center Panel Right				
12	Right Rear Door	93.7	100	93	89
13	Right Back Panel	100.5	103	101	98

Overall Evaluation :

B

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (R) Front Seat - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Small	Remarks (L) Rear Fender - Repair Traces - Yes / (L) Rear Door, Molding - Scratch & Dent - Medium / (L) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Dent - Medium / Roof - Dent - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes

with LTO plate number/with warranty booklet/ No spare tire/jack/ incomplete tools/front Dashcam loose/ spare tire cover missing/rim only no tire