

General Information

Date & Time: 24, Feb, 2026 16:56

Make	Toyota	Model	Hilux
YOM	2025	Odo Meter Reading	27,197
Registration No.	VAB8085	Chassis No.	MR0JB8DD9R3553253
CC	2.4	Transmission	A/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	Silver		

Body / Panel Condition



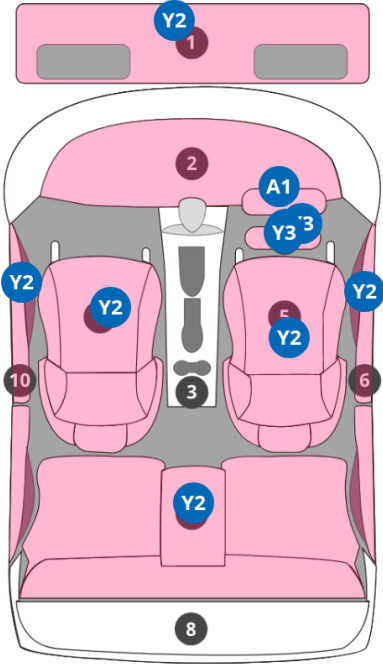
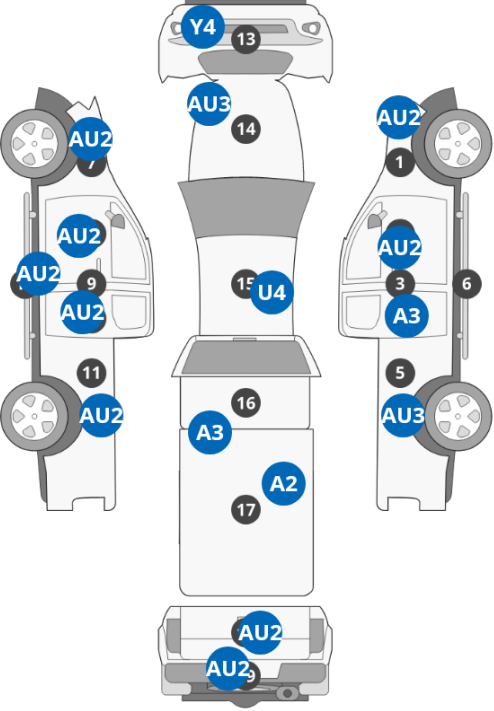
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	121	112	120
2	Boot Lid	101.4	94	99	111
3	Roof	119.2	107	106	147/117
4	Left Front Fender	109.0	103	114	110
5	Left Front Door	114.3	113	117	113
6	Center Panel Left	118.0	116	126	112
7	Left Rear Door	109.3	112	112	104
8	Left Back Panel	131.6	121	145	129
9	Right Front Fender	141.3	132	136	156
10	Right Front Door	121.3	120	121	123
11	Center Panel Right	128.3	130	133	122
12	Right Rear Door	116.0	104	116	128
13	Right Back Panel	114.3	117	117	109

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (R) Front Trim - Grime - Small / Rear Seat - Grime - Small / (L) Front Floor Mat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / Mat Other - Grime - Medium / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / Ceiling - Grime - Small / Glove Box - Worn, Scratch, Cut, Crack - Minimal</p>	<p>Remarks (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch & Dent - Medium / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch - Medium / (L) Front Door, Molding - Scratch & Dent - Small / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Side Gate - Scratch & Dent - Small / Rear Gate - Scratch & Dent - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / Cargo Bed Floor - Scratch - Small / Cab Back Panel - Scratch - Medium / (R) Side Gate - Scratch & Dent - Medium / Roof - Dent - Large</p>
Frame Evaluation : C	Functional Evaluation : A
<p>Remarks Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare tire, with reverse camera ,no tools and jack, no warranty and manual booklet, issue on headlight and foglamps, scratches on tailight,no spare key.</p>