

General Information

Date & Time: 04, Feb, 2025 13:19

Make	Toyota	Model	Vios
YOM	2022	Mileage	31,679
Registration No.	DBB4719	Chassis No.	PA1B18F3XN4173650
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



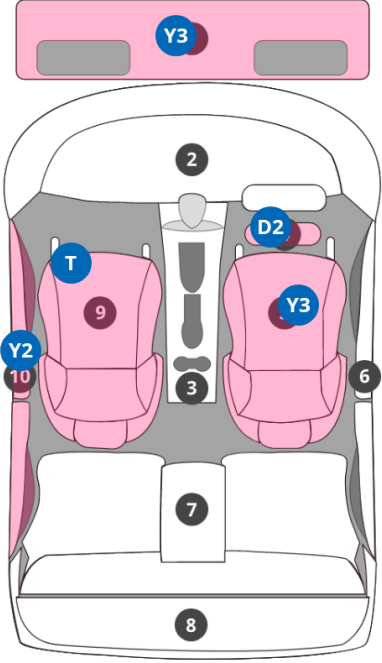
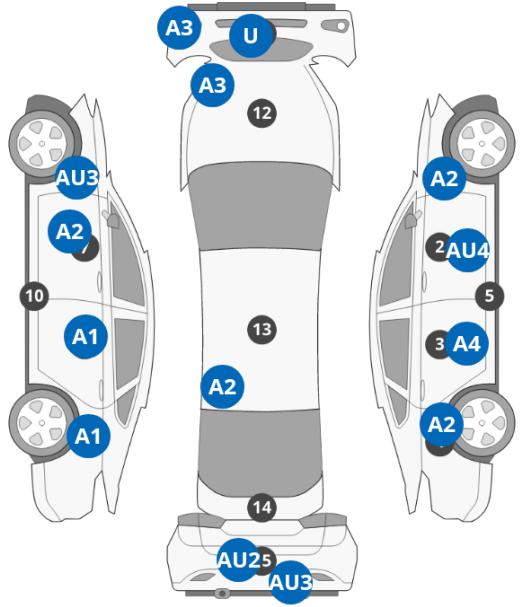
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	111.6	115	110	110
2	Boot Lid	117.8	99	113	142
3	Roof	98.1	103	95	91/103
4	Left Front Fender	92.2	94	96	87
5	Left Front Door	99.3	97	100	101
6	Center Panel Left				
7	Left Rear Door	99.9	108	101	91
8	Left Back Panel	107.4	112	111	99
9	Right Front Fender	109.1	105	96	126
10	Right Front Door	92.1	99	92	86
11	Center Panel Right				
12	Right Rear Door	98.1	94	95	106
13	Right Back Panel	98.2	93	104	98

Overall Evaluation :

C

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Cigarette Burns - Burnt, Hole / Ceiling - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Front Door, Molding - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch & Dent - Medium / Member (Bolted) - Dent - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Medium
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
with warranty booklet, with spare tire, with jack and tools, with LTO plate, crack on front bumper