

General Information

Date & Time: 24, Feb, 2026 14:25

Make	Toyota	Model	Hilux Tamaraw
YOM	2025	Odo Meter Reading	4,515
Registration No.	GBK5644	Chassis No.	PAHACACA8S6421394
CC	2.4	Transmission	M/T
Fuel Type	Diesel	Type of Body	Pickup
Colour	White		

Body / Panel Condition



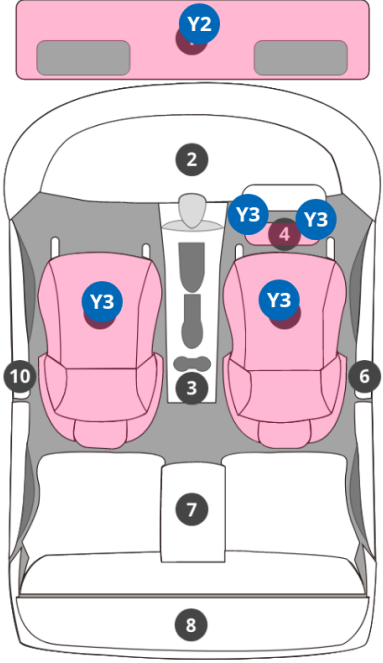
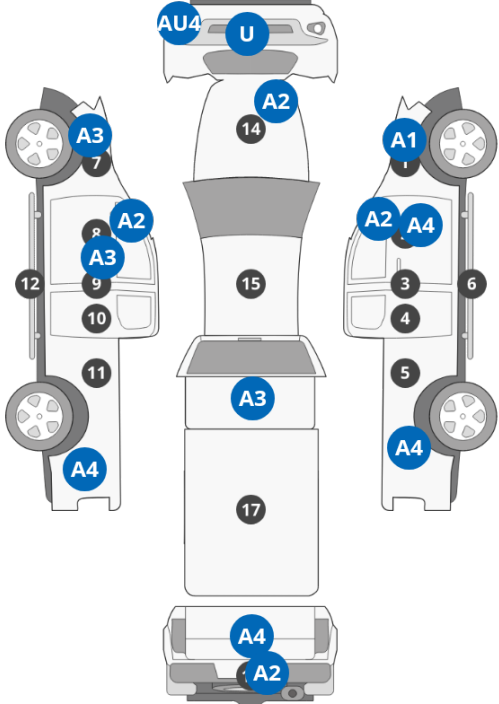
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	102	106	110
2	Boot Lid	62.4	60	63	64
3	Roof	108.0	116	104	105/107
4	Left Front Fender	109.6	107	110	112
5	Left Front Door	106.3	106	111	102
6	Center Panel Left				
7	Left Rear Door				
8	Left Back Panel	65.3	67	63	66
9	Right Front Fender	106.0	104	102	112
10	Right Front Door	105.6	101	106	110
11	Center Panel Right				
12	Right Rear Door				
13	Right Back Panel	63.0	56	64	69

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Ceiling - Grime - Small / (R) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (L) Front Seat - Grime - Medium / (L) Front Floor Mat - Grime - Medium</p>	<p>Remarks Member (Bolted) - Dent - Yes / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Side Gate - Scratch - Large / (R) Side Gate - Scratch - Large / Rear Gate - Scratch - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Cab Back Panel - Scratch - Medium</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Right reverse light busted. Gap at front bumper. Without warranty booklet and tools. With spare tire and jack. 1 key. With LTO plate.</p>