

General Information

Date & Time: 02, Mar, 2026 08:01

Make	Toyota	Model	Innova
YOM	2022	Odo Meter Reading	16,097
Registration No.	EAE7143	Chassis No.	PA2JA8EM1N0102264
CC	2.8	Transmission	M/T
Fuel Type	Diesel	Type of Body	Wagon
Colour	Blackish Red Mica		

Body / Panel Condition



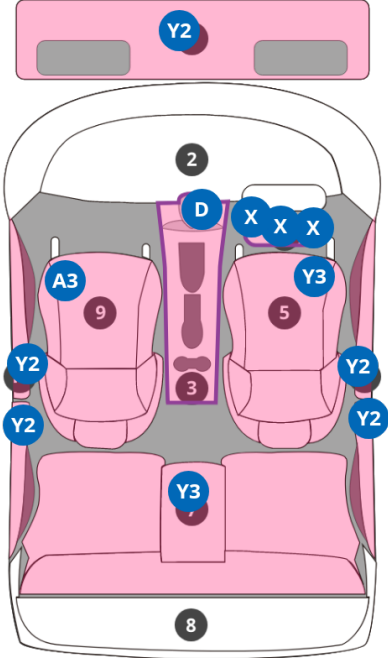
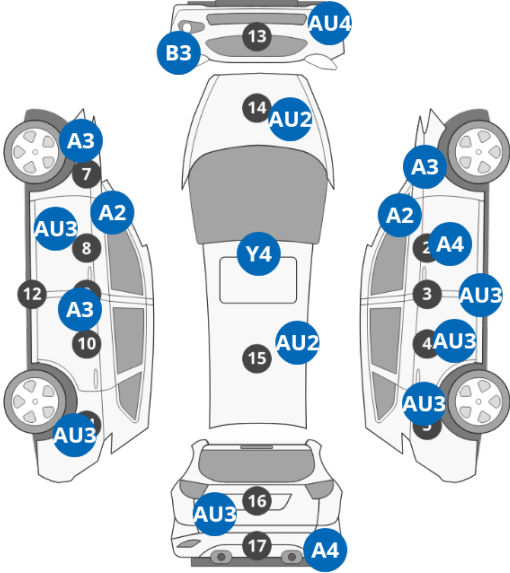
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.3	108	118	111
2	Boot Lid	96.4	98	94	97
3	Roof	91.7	98	94	89/87
4	Left Front Fender	103.2	104	106	100
5	Left Front Door	107.6	115	107	101
6	Center Panel Left				
7	Left Rear Door	111.3	111	110	113
8	Left Back Panel	109.0	112	109	106
9	Right Front Fender	107.3	102	110	110
10	Right Front Door	107.0	99	104	118
11	Center Panel Right				
12	Right Rear Door	137.0	135	153	123
13	Right Back Panel	108.6	107	110	109

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / (L) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / Console, Switches, Vents - Traces of Adhesive Tape - Yes / (R) Front Seat - Grime - Medium / (R) Rear Trim - Grime - Small / Ceiling - Grime - Small / (L) Rear Trim - Grime - Small / Rear Seat - Grime - Medium / (L) Front Seat - Cut, Crack - Medium / (L) Front Trim - Grime - Small / Room Mirror - Missing - Yes / Display, Audio System - Partially Missing - Yes</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / Front Windshield - Damaged - Large / (L) Front Fender, Molding - Scratch - Medium / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Scratch - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / (R) Rear Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Large / (R) Mirror - Scratch - Small / (R) Front Fender, Molding - Scratch - Medium / Front Bumper, Grille, Lamps - Modified - Medium / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Roof - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Wiper - Function - Weak / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Double registration with LTO apprehension. Possible flooding. Damaged front windshield. Rear view mirror missing. No reverse light. No Horn. Without warranty booklet, jack, tools and seat cover. With spare tire. 1 key. With LTO plate.</p>