

General Information

Date & Time: 24, Feb, 2026 16:07

Make	Toyota	Model	Rush
YOM	2022	Odo Meter Reading	98,786
Registration No.	NGX5910	Chassis No.	MHKE8FF3PNK041090
CC	1.5	Transmission	A/T
Fuel Type	Gas	Type of Body	SUV
Colour	Red Mica Metallic		

Body / Panel Condition



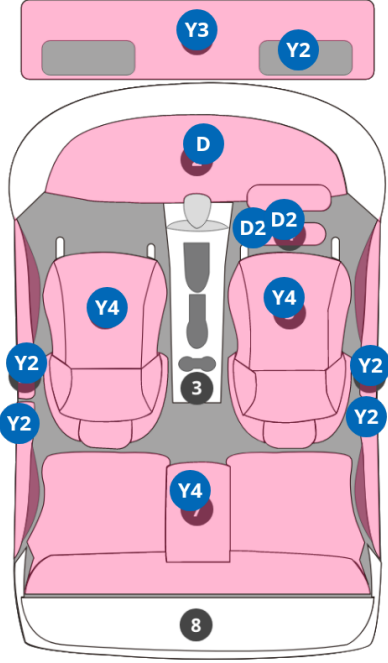
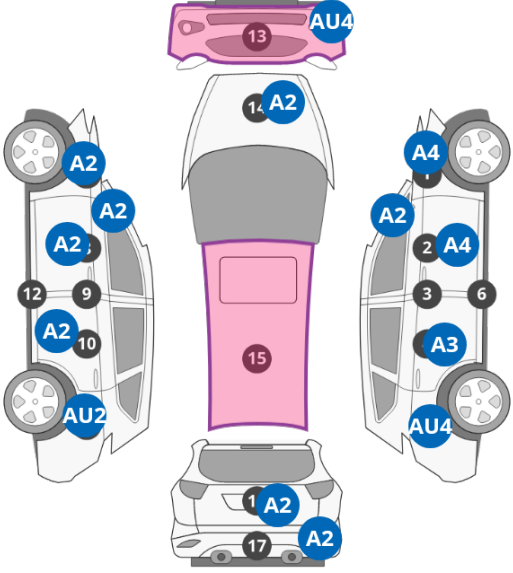
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	114.0	110	121	111
2	Boot Lid	92.7	100	91	88
3	Roof	213.0	204	205	220/223
4	Left Front Fender	107.0	106	105	110
5	Left Front Door	113.0	122	112	105
6	Center Panel Left				
7	Left Rear Door	104.6	107	106	101
8	Left Back Panel	108.3	106	108	111
9	Right Front Fender	105.5	110	108	99
10	Right Front Door	120.3	112	125	124
11	Center Panel Right				
12	Right Rear Door	109.0	102	112	113
13	Right Back Panel	105.0	108	100	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : E	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Seat - Grime - Large / Dashboard - Traces of Adhesive Tape - Yes / Sunvisor, Sunglass Holder - Grime - Small / (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Large / Ceiling - Grime - Medium / (L) Rear Trim - Grime - Small / (R) Rear Trim - Grime - Small / Mat Other - Worked - Small / (R) Front Trim - Grime - Small / (R) Front Seat - Grime - Large	Remarks Roof - Repair Traces - Yes / Roof - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Fender, Molding - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Large / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small
Frame Evaluation : A	Functional Evaluation : B
Remarks Defects not found	Remarks Retractable Mirror - Issue - Yes / Battery - Weak - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Spare Key - Issue - Unexist

Inspector Notes
Possible flooding. Side mirror switches issue. Roof was wrapped in black. right foglight busted. Left foglight cover repaired. Without warranty booklet, tools, jack and seat cover. With spare tire. 1 key. With LTO plate.