

General Information

Date & Time: 24, Feb, 2026 16:41

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	15,182
Registration No.	GBK6966	Chassis No.	PA1B18F3XS4290771
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



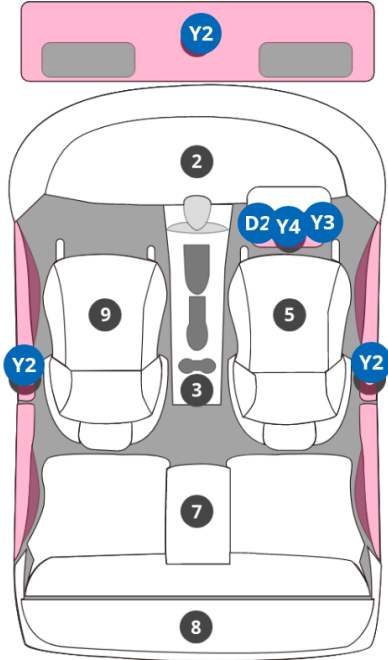
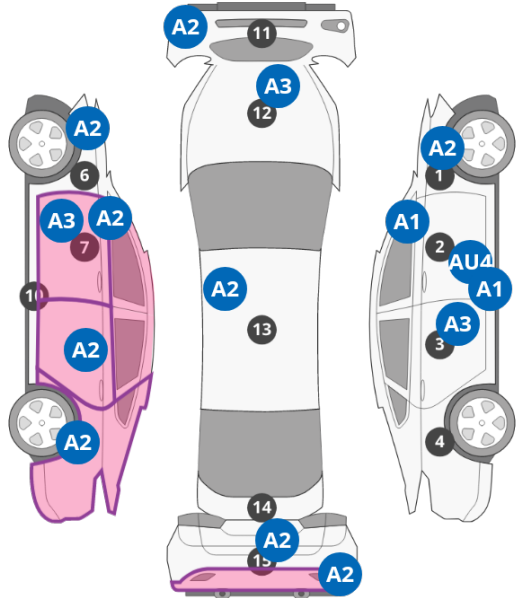
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	117.6	124	113	116
2	Boot Lid	109.0	102	108	117
3	Roof	100.5	100	100	97/106
4	Left Front Fender	95.2	98	92	96
5	Left Front Door	186.6	133	142	285
6	Center Panel Left				
7	Left Rear Door	190.3	244	177	150
8	Left Back Panel	146.0	159	141	138
9	Right Front Fender	96.2	97	90	102
10	Right Front Door	102.4	110	100	97
11	Center Panel Right				
12	Right Rear Door	101.8	94	100	112
13	Right Back Panel	106.3	101	105	113

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Trim - Grime - Small / (L) Front Floor Mat - Worked - Small / Ceiling - Grime - Small / Mat Other - Grime - Large / (R) Front Trim - Grime - Small / (R) Front Floor Mat - Grime - Medium</p>	<p>Remarks (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Front Fender, Molding - Scratch - Small / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Medium / (L) Front Door, Molding - Repair mark - Yes / (L) Rear Door, Molding - Repair mark - Yes / (L) Rear Fender, Molding - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Repair mark - Yes / Rear Bumper, Lamps, Panels - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Small / Roof - Scratch - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>Left front and rear door, and left rear fender repainted. Without warranty booklet. With spare tire, jack, tools and seat cover. 1 key but aftermarket not original. With LTO plate.</p>