

General Information

Date & Time: 03, Mar, 2026 08:04

Make	Toyota	Model	Wigo
YOM	2024	Odo Meter Reading	25,757
Registration No.	GBC7454	Chassis No.	MHKAA1BC7RJ015252
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	Hatchback
Colour	Orange		

Body / Panel Condition



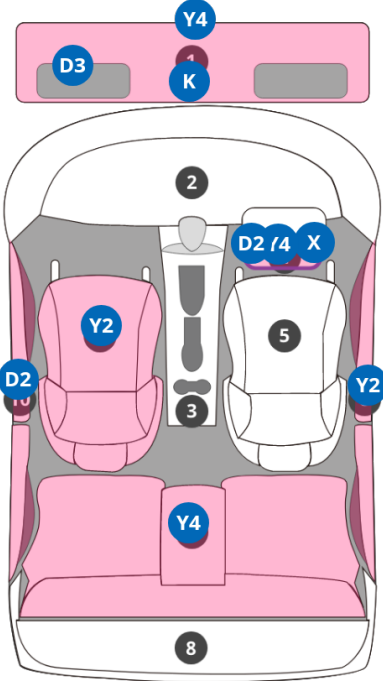
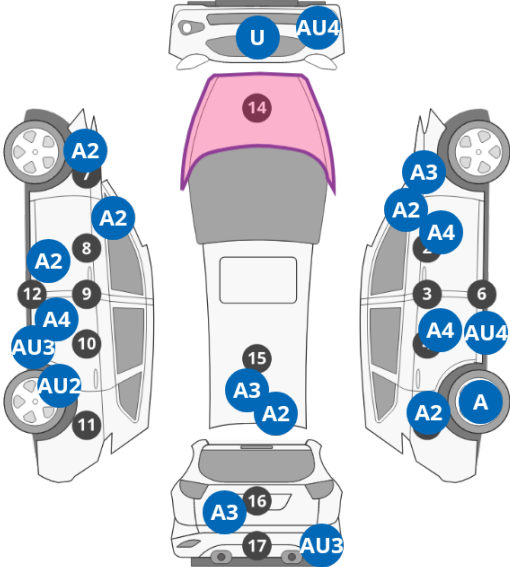
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	37.5	33	43	37
2	Boot Lid	92.2	85	95	97
3	Roof	87.1	83	85	97/84
4	Left Front Fender	92.2	86	100	91
5	Left Front Door	107.2	99	109	114
6	Center Panel Left				
7	Left Rear Door	106.2	112	118	89
8	Left Back Panel	96.0	102	91	95
9	Right Front Fender	90.5	89	80	102
10	Right Front Door	121.6	116	142	107
11	Center Panel Right				
12	Right Rear Door	99.2	88	101	109
13	Right Back Panel	85.9	90	82	86

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (R) Front Floor Mat - Missing - Yes / (R) Front Trim - Grime - Small / Mat Other - Grime - Large / Overall Interior - Animal Hair - Yes / Ceiling - Grime - Large / Rear Seat - Grime - Large / (L) Front Seat - Grime - Small / (L) Front Floor Mat - Worked - Small / (L) Front Trim - Worked - Small / Sunvisor, Sunglass Holder - Crinkle - Medium</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Bonnet, Headlight - Repair mark - Difference in Color / (R) Front Fender, Molding - Scratch - Medium / (R) Front Door, Molding - Scratch - Large / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Medium / (R) Rear Tyre - Crack, Cut - Yes / (L) Rear Fender, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (L) Rear Door, Molding - Scratch - Large / (L) Mirror - Scratch - Small / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (R) Mirror - Scratch - Small / Roof - Scratch - Medium / Roof Spoiler, Molding - Scratch - Small / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : B	Functional Evaluation : C
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Warning Lamps - Issue - Yes / Battery - Weak - Yes</p>

<p>Inspector Notes</p>
<p>Possible flooding. Bonnet was replaced to black. Maintenance warning lamp. Scratches on headlight and taillight. Punctured rear right tire. With warranty booklet, spare tire and seat cover. Without jack and tools. 2 keys. No LTO plate.</p>