

General Information

Date & Time: 24, Feb, 2026 14:19

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	24,846
Registration No.	FAP7244	Chassis No.	PA1B18F31P4224553
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



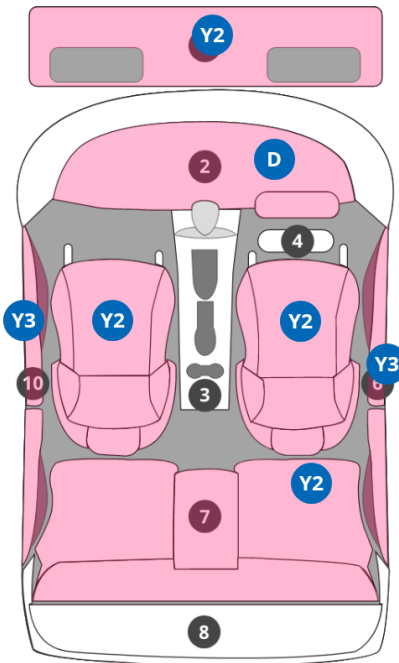
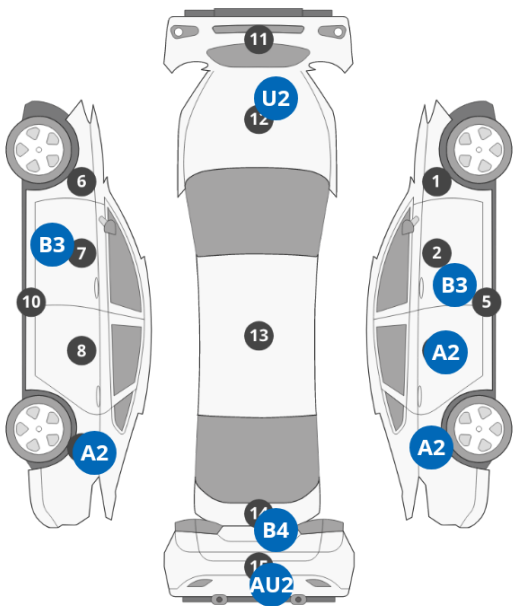
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.0	110	104	104
2	Boot Lid	105.0	108	101	106
3	Roof	90.3	94	84	86/98
4	Left Front Fender	92.2	91	88	98
5	Left Front Door	91.4	91	87	97
6	Center Panel Left				
7	Left Rear Door	99.2	101	101	96
8	Left Back Panel	99.8	104	98	98
9	Right Front Fender	93.9	93	94	95
10	Right Front Door	92.2	94	89	94
11	Center Panel Right				
12	Right Rear Door	96.8	92	95	103
13	Right Back Panel	94.8	94	92	98

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : C
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (R) Front Trim - Grime - Medium / (R) Front Seat - Grime - Small / (L) Front Seat - Grime - Small / Rear Seat - Grime - Small / Ceiling - Grime - Small / Dashboard - Traces of Adhesive Tape - Yes / (L) Front Trim - Grime - Medium	Remarks (R) Front Door - Repair Traces - Yes / (R) Step - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / Trunk Hood, Rear Gate - Modified - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch & Dent - Small / (L) Front Door, Molding - Modified - Medium / (R) Front Door, Molding - Modified - Medium / (R) Rear Door, Molding - Scratch - Small / Bonnet, Headlight - Dent - Small / (L) Rear Fender, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : C
Remarks Defects not found	Remarks Power Steering - Issue - Yes / Battery - Weak - Yes / Reverse Camera - N/A - Yes

Inspector Notes
Engine cover missing. Possible flooded. foul smell. With spare 2 keys. With seat cover. With spare tire. with warranty booklet