


General Information

Date & Time: 25, Feb, 2026 07:52

| | | | |
|-------------------------|----------------------|--------------------------|-------------------|
| Make | Toyota | Model | Avanza |
| YOM | 2025 | Odo Meter Reading | 3,208 |
| Registration No. | DBU1774 - NON-MOVING | Chassis No. | MHFAA1BY8S0040408 |
| CC | 1.3 | Transmission | CVT |
| Fuel Type | Gas | Type of Body | Wagon |
| Colour | Silver | | |

Body / Panel Condition

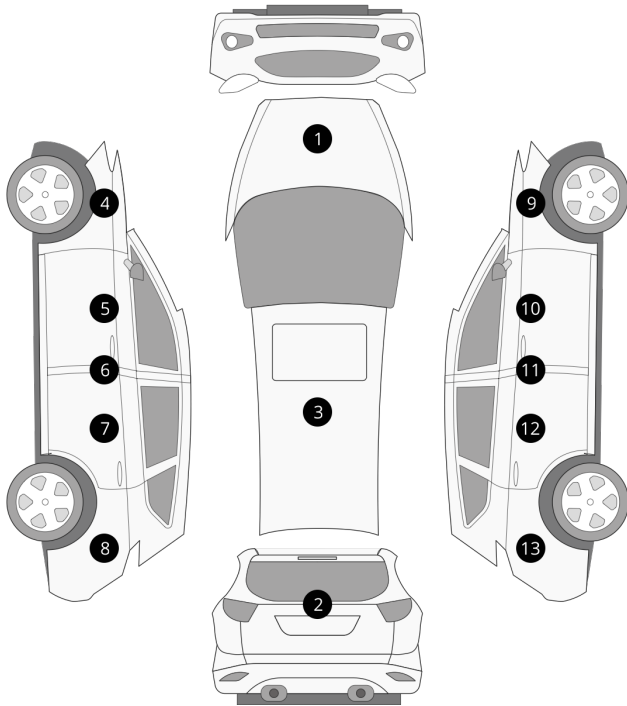

| # | Area | Thickness(um) | | | |
|----|--------------------|---------------|--------|--------|----------|
| | | Average | Value1 | Value2 | Value3/4 |
| 1 | Bonnet | 88.1 | 88 | 89 | 88 |
| 2 | Boot Lid | 89.3 | 87 | 89 | 91 |
| 3 | Roof | 89.3 | 89 | 92 | 91/86 |
| 4 | Left Front Fender | 89.0 | 88 | 89 | 90 |
| 5 | Left Front Door | 89.3 | 88 | 91 | 89 |
| 6 | Center Panel Left | | | | |
| 7 | Left Rear Door | 89.3 | 90 | 88 | 90 |
| 8 | Left Back Panel | 91.4 | 90 | 93 | 91 |
| 9 | Right Front Fender | 89.7 | 92 | 90 | 88 |
| 10 | Right Front Door | 85.9 | 84 | 88 | 86 |
| 11 | Center Panel Right | | | | |
| 12 | Right Rear Door | 85.0 | 86 | 83 | 86 |
| 13 | Right Back Panel | 87.5 | 90 | 87 | 86 |

Overall Evaluation :

E

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is" and "DBU1774 - NON-MOVING". This report shall not be subject to arbitration.

| | |
|---|--|
| Interior Evaluation : D | Exterior Evaluation : E |
| <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p> | <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p> |
| <p>Remarks Dashboard - Loose, Deformed - Large / Glove Box - Loose, Deformed - Large / Instrument Panel - Loose, Deformed - Large / Steering Wheel - Worn, Peel, Crack - Large / (L) Front Floor Mat - Worked - Small / (R) Front Floor Mat - Worked - Small / Mat Other - Worked - Large</p> | <p>Remarks Bonnet, Headlight - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / (R) Front Fender, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Crack, Gap - Large / (L) Front Door, Molding - Crack, Gap - Large / (L) Rear Door, Molding - Scratch - Small / Front Windshield - Damaged - Large / (L) Rear Fender, Molding - Scratch - Small / Trunk Hood, Rear Gate - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Small / (R) Rear Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Small</p> |
| Frame Evaluation : D | Functional Evaluation : E |
| <p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside Panel (Front Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Left Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes / Right Front Inside (Rear Side) - Traces of Bending, or Marks of Panel Repair ? - Yes</p> | <p>Remarks Warning Lamps - Issue - Yes / Panel, Meter - Issue - Yes / Power Steering - Issue - Yes / Power Steering Pump - Leak - Yes / Radiator Water Pump - Leak - Yes / Battery - Weak - Yes / Parking Brake - Function - Weak / Head Light, High Beam - Issue - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes / Wiper - Function - Weak / Spare Key - Issue - Unexist</p> |

| |
|---|
| Inspector Notes |
| non moving vehicle/ airbag issue/ wiper issue/ headlight issue/ no jack and tools/ no LTO plate/ with spare tire/ with warranty booklet |