

General Information

Date & Time: 25, Feb, 2026 12:58

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	58,910
Registration No.	NKH3619	Chassis No.	PA1B18F34R4275872
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red Mica Metallic		

Body / Panel Condition



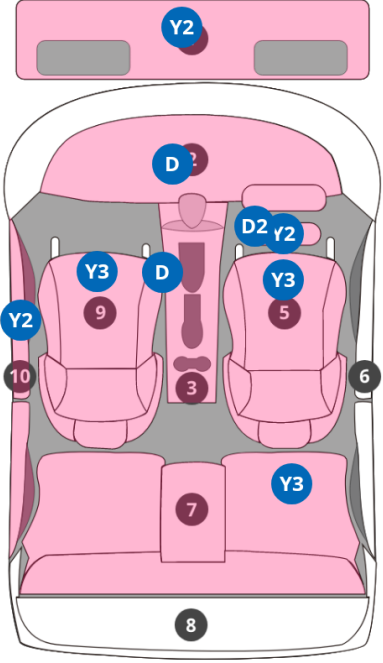
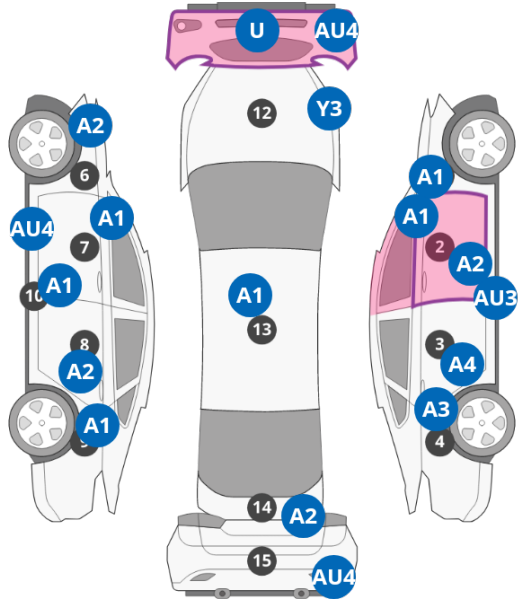
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	360.0	752	187	141
2	Boot Lid	103.9	106	93	113
3	Roof	88.7	93	92	79/92
4	Left Front Fender	225.0	228	314	133
5	Left Front Door	102.0	100	103	103
6	Center Panel Left				
7	Left Rear Door	102.6	101	104	103
8	Left Back Panel	105.6	106	111	100
9	Right Front Fender	97.6	97	96	100
10	Right Front Door	140.6	151	137	134
11	Center Panel Right				
12	Right Rear Door	96.6	96	94	100
13	Right Back Panel	93.8	94	93	95

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Trim - Grime - Small / Mat Other - Grime - Small / (L) Front Floor Mat - Worked - Small / Rear Seat - Grime - Medium / Dashboard - Traces of Adhesive Tape - Yes / Ceiling - Grime - Small / Console, Switchs, Vents - Traces of Adhesive Tape - Yes</p>	<p>Remarks (R) Front Fender - Repair Traces - Yes / Bonnet - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Member (Bolted) - Dent - Yes / (R) Front Door, Molding - Repair mark - Yes / (R) Mirror - Scratch - Minimal / (R) Front Fender, Molding - Scratch - Minimal / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch - Small / (L) Rear Fender, Molding - Scratch - Minimal / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Minimal</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>no warranty booklet and jack, incomplete tools, with spare tire, with LTO plate, scratched and cracked tail light, possible flooding,</p>