

General Information

Date & Time: 02, Mar, 2026 15:53

Make	Toyota	Model	Vios
YOM	2021	Odo Meter Reading	170,741
Registration No.	DAV5538	Chassis No.	PA1B18F37M4149269
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Red		

Body / Panel Condition



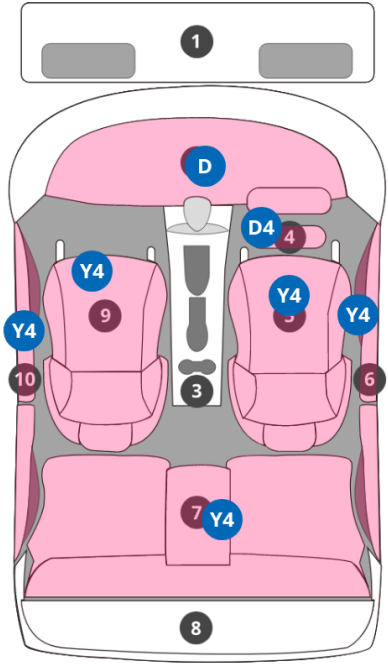
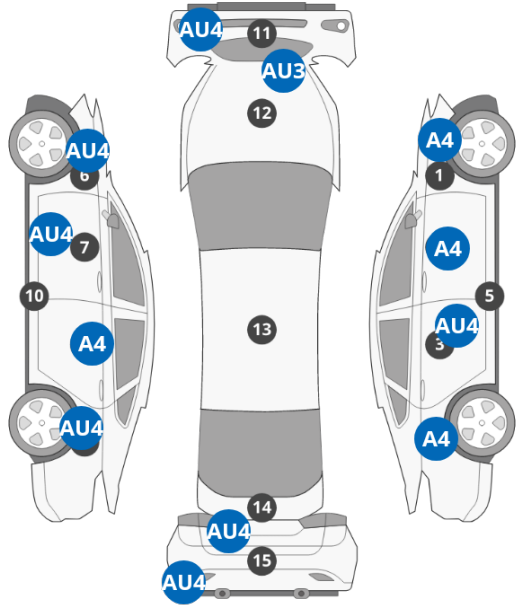
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	110.3	112	108	111
2	Boot Lid	104.3	105	103	105
3	Roof	97.2	104	90	90/105
4	Left Front Fender	96.8	92	99	100
5	Left Front Door	94.4	95	94	95
6	Center Panel Left				
7	Left Rear Door	96.7	95	98	98
8	Left Back Panel	98.3	96	97	102
9	Right Front Fender	216.0	148	144	356
10	Right Front Door	99.4	98	100	101
11	Center Panel Right				
12	Right Rear Door	99.3	96	101	101
13	Right Back Panel	102.5	105	100	103

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation :	E	Exterior Evaluation :	E
			
<p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>		<p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>	
<p>Remarks (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Large / Rear Seat - Grime - Large / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / (L) Front Floor Mat - Worked - Large / Dashboard - Traces of Adhesive Tape - Yes</p>		<p>Remarks (R) Front Fender - Repair Traces - Yes / Trunk Hood, Rear Gate - Scratch & Dent - Large / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch - Large / (L) Front Door, Molding - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Large / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch & Dent - Medium / (R) Front Fender, Molding - Scratch - Large / (R) Front Door, Molding - Scratch - Large / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch - Large</p>	
Frame Evaluation :	A	Functional Evaluation :	B
<p>Remarks Defects not found</p>		<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist</p>	

Inspector Notes
possible flooding/ abnormal engine noise/ no tools and spare tire/ with jack / with LTO plate