

General Information

Date & Time: 25, Feb, 2026 13:58

Make	Toyota	Model	Avanza
YOM	2025	Odo Meter Reading	6,132
Registration No.	DBU6437	Chassis No.	MHFAA1BYXS0041592
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Wagon
Colour	Silver		

Body / Panel Condition



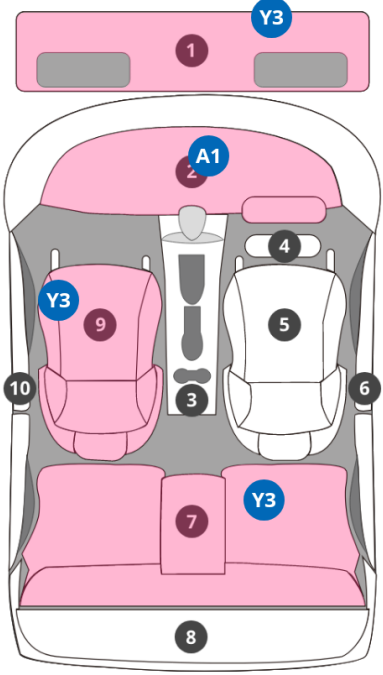
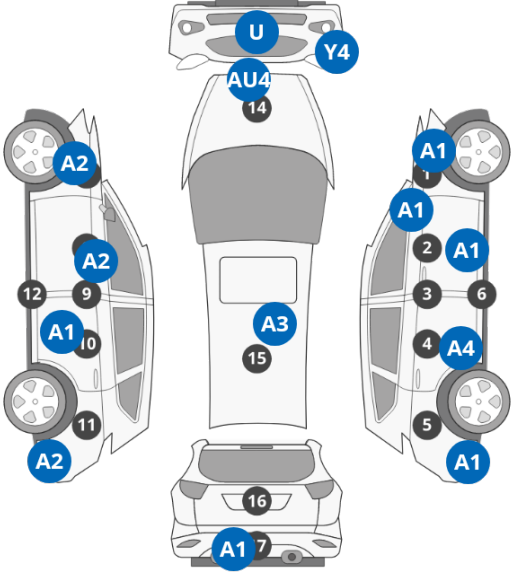
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	104.0	98	102	112
2	Boot Lid	88.3	82	96	87
3	Roof	111.2	119	112	100/114
4	Left Front Fender	95.5	105	91	91
5	Left Front Door	109.0	98	113	116
6	Center Panel Left				
7	Left Rear Door	99.8	103	96	101
8	Left Back Panel	117.3	115	108	129
9	Right Front Fender	105.6	107	102	108
10	Right Front Door	109.0	116	111	100
11	Center Panel Right				
12	Right Rear Door	104.3	108	101	104
13	Right Back Panel	168.3	188	168	149

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Glove Box - Worn, Scratch, Cut, Crack - Minimal / Ceiling - Grime - Medium / (L) Front Seat - Grime - Medium / Rear Seat - Grime - Medium</p>	<p>Remarks (R) Rear Fender - Repair Traces - Yes / Front Bumper, Grille, Lamps - Crack, Gap - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Mirror - Scratch, Peeled - Minimal / (R) Front Door, Molding - Scratch - Minimal / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Minimal / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Small / (L) Rear Door, Molding - Scratch - Minimal / (L) Front Door, Molding - Scratch - Small / (L) Front Fender, Molding - Scratch - Small / Bonnet, Headlight - Scratch & Dent - Large / Roof - Scratch - Medium / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : B	Functional Evaluation : A
<p>Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p>Remarks Spare Key - Issue - Unexist</p>

<p>Inspector Notes</p>
<p>With LTO plate, with warranty booklet, with spare tire, with jack, no tools, scratches on tail lights</p>