

## General Information

Date & Time: 26, Feb, 2026 09:01

<b>Make</b>	Toyota	<b>Model</b>	Hilux
<b>YOM</b>	2024	<b>Odo Meter Reading</b>	72,150
<b>Registration No.</b>	CCA2369	<b>Chassis No.</b>	MR0AB8DD5P5149416
<b>CC</b>	2.4	<b>Transmission</b>	A/T
<b>Fuel Type</b>	Diesel	<b>Type of Body</b>	Pickup
<b>Colour</b>	Red		

## Body / Panel Condition



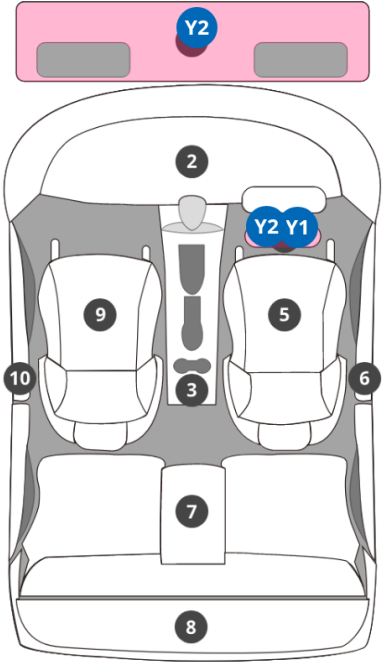
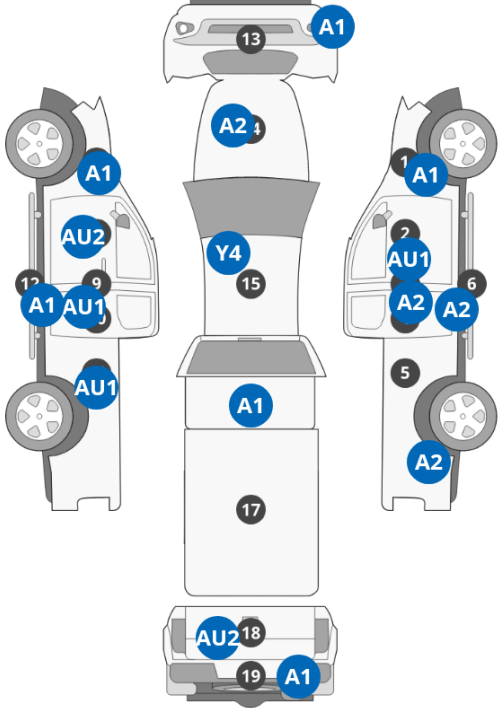
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	125.0	125	131	119
2	Boot Lid	102.1	111	100	95
3	Roof	121.5	117	107	136/126
4	Left Front Fender	108.6	109	109	108
5	Left Front Door	121.0	116	123	124
6	Center Panel Left				
7	Left Rear Door	108.3	115	108	102
8	Left Back Panel	115.6	105	121	121
9	Right Front Fender	102.8	105	106	98
10	Right Front Door	109.3	120	107	101
11	Center Panel Right				
12	Right Rear Door	104.4	94	102	117
13	Right Back Panel	112.3	114	111	112

## Overall Evaluation :

A

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>	<b>Exterior Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">C</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Small / (R) Front Floor Mat - Grime - Minimal / (L) Front Floor Mat - Grime - Small</p>	<p><b>Remarks</b> Front Windshield - Damaged - Large / (R) Front Fender, Molding - Scratch - Minimal / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Step, In-panel, Side Spoiler - Scratch - Small / (R) Rear Door, Molding - Scratch - Small / (R) Side Gate - Scratch - Small / Rear Gate - Scratch &amp; Dent - Small / Rear Bumper, Lamps, Panels - Scratch - Minimal / (L) Side Gate - Scratch &amp; Dent - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Minimal / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Scratch - Minimal / Bonnet, Headlight - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>	<b>Functional Evaluation :</b> <span style="color: red; font-size: 24px; float: right;">A</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with spare tire, 1key, no warranty booklet, no jack and tools, scratches on headlights, crack taillights</p>