

General Information

Date & Time: 26, Feb, 2026 12:08

Make	Toyota	Model	Vios
YOM	2022	Odo Meter Reading	119,043
Registration No.	CBD4991	Chassis No.	PA1B18F37N418168
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blue		

Body / Panel Condition



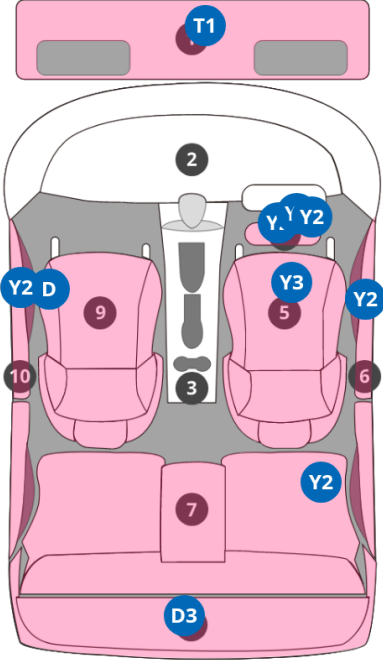
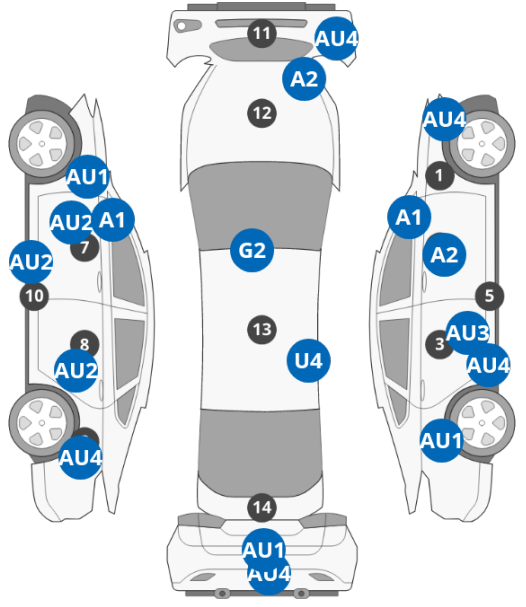
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	109.3	114	107	107
2	Boot Lid	109.0	111	97	119
3	Roof	95.0	107	93	91/89
4	Left Front Fender	97.9	96	103	95
5	Left Front Door	99.8	102	103	95
6	Center Panel Left				
7	Left Rear Door	103.9	109	104	99
8	Left Back Panel	106.7	111	95	114
9	Right Front Fender	99.5	102	100	97
10	Right Front Door	103.0	101	108	100
11	Center Panel Right				
12	Right Rear Door	104.2	116	99	98
13	Right Back Panel	104.0	101	101	110

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : C	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks Ceiling - Cigarette Burns - Burnt Minimal / Room Mirror - Partially Missing - Yes / (L) Front Floor Mat - Grime - Small / (R) Front Floor Mat - Grime - Large / (R) Front Seat - Grime - Medium / (R) Front Trim - Grime - Small / (L) Front Seat - Worn - Yes / (L) Front Trim - Grime - Small / Mat Other - Grime - Small / Trunk Room - Loose, Deformed - Medium / Rear Seat - Grime - Small / Overall Interior - Worn as per age - Yes	Remarks (R) Front Fender, Molding - Scratch & Dent - Large / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch - Small / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Large / (R) Rear Door, Molding - Scratch & Dent - Medium / Roof - Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Minimal / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / Trunk Hood, Rear Gate - Scratch & Dent - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Large / (L) Rear Door, Molding - Scratch & Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch & Dent - Minimal / Front Bumper, Grille, Lamps - Scratch & Dent - Large / Bonnet, Headlight - Scratch - Small / Front Windshield - Scratch, Stone chip - Small
Frame Evaluation : B	Functional Evaluation : A
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Reverse Camera - N/A - Yes / Spare Key - Issue - Unexist

Inspector Notes
With Lto plate, with spare tire and jack, 1key, no warranty booklet and tools, scratches on headlights and taillights, trunk room cover missing, room mirror issue