

General Information

Date & Time: 03, Feb, 2025 18:33

Make	Toyota	Model	Raize
YOM	2023	Mileage	19,071
Registration No.	NHJ4149	Chassis No.	MHKAA1BA4PJ093063
CC	1.0	Transmission	CVT
Fuel Type	Gas	Type of Body	SUV
Colour	Blue		

Body / Panel Condition



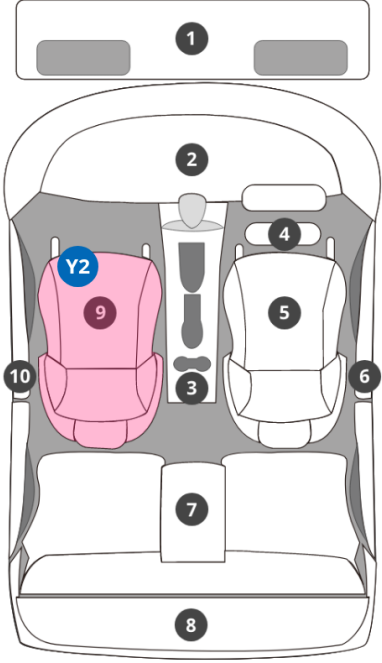
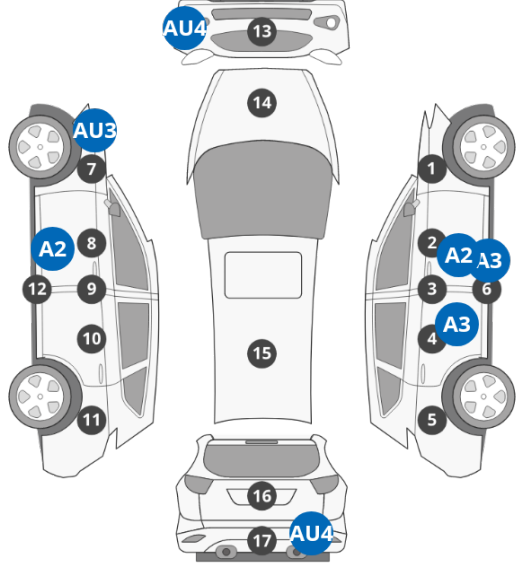
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.6	125	135	135
2	Boot Lid	111.3	115	119	100
3	Roof	96.9	101	117	81/89
4	Left Front Fender	207.6	201	222	200
5	Left Front Door	165.3	154	168	174
6	Center Panel Left				
7	Left Rear Door	155.0	168	137	160
8	Left Back Panel	162.6	168	151	169
9	Right Front Fender	183.0	191	194	164
10	Right Front Door	226.0	241	220	217
11	Center Panel Right				
12	Right Rear Door	138.3	152	133	130
13	Right Back Panel	150.3	159	146	146

Overall Evaluation :

A

Disclaimer

This Grading Report is intended to record the general appearance and condition of the interior, exterior & frame of the vehicle. This is not a detailed inspection report. This is issued on the date and time given herein and the company shall not be liable for the condition of the vehicle after this date and time. Any disputes regarding this report shall not be grounds for arbitration.

Interior Evaluation : A	Exterior Evaluation : C
 a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain	 A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap
Remarks (L) Front Seat - Grime - Small	Remarks (R) Front Door - Repair Traces - Yes / (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / Front Bumper, Grille, Lamps - Scratch & Dent - Large / (L) Front Fender, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Medium / (R) Front Door, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch & Dent - Large / (L) Front Door, Molding - Scratch - Small
Frame Evaluation : A	Functional Evaluation : A
Remarks Defects not found	Remarks Defects not found

Inspector Notes
with warranty booklet /incomplete tools/ with spare tire/ with jack/ with LTO plate/