

General Information

Date & Time: 26, Feb, 2026 14:28

Make	Toyota	Model	Vios
YOM	2024	Odo Meter Reading	29,614
Registration No.	DBO6855	Chassis No.	PA1B18F31R4253781
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Blackish Red Mica		

Body / Panel Condition



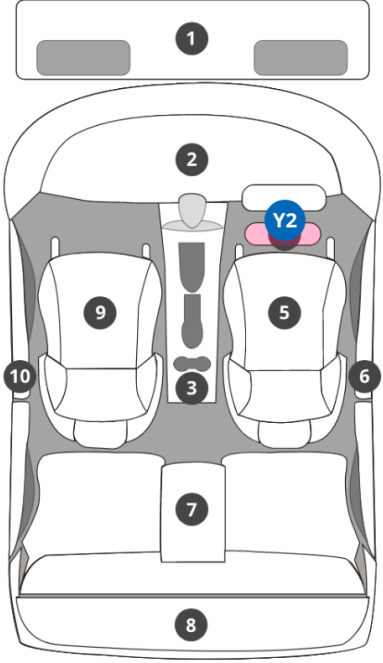
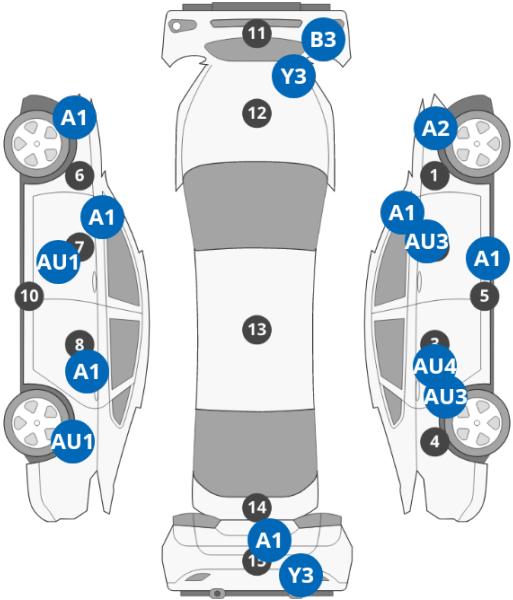
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	131.0	135	138	120
2	Boot Lid	117.0	118	113	120
3	Roof	97.1	111	94	89/94
4	Left Front Fender	102.1	98	104	104
5	Left Front Door	100.6	98	108	96
6	Center Panel Left				
7	Left Rear Door	104.0	107	104	101
8	Left Back Panel	106.0	111	102	105
9	Right Front Fender	101.2	104	102	98
10	Right Front Door	98.3	96	98	101
11	Center Panel Right				
12	Right Rear Door	98.3	95	100	100
13	Right Back Panel	102.0	98	96	112

Overall Evaluation :

B

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : A	Exterior Evaluation : D
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
Remarks (L) Front Floor Mat - Grime - Small	Remarks (R) Front Fender, Molding - Scratch - Small / (R) Mirror - Scratch - Minimal / (R) Front Door, Molding - Scratch & Dent - Medium / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Rear Fender, Molding - Scratch & Dent - Medium / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch & Dent - Minimal / (L) Rear Door, Molding - Scratch - Minimal / (L) Mirror - Scratch - Minimal / (L) Front Door, Molding - Scratch & Dent - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Modified - Medium / Bonnet, Headlight - Crack, Gap - Medium
Frame Evaluation : B	Functional Evaluation : B
Remarks Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes	Remarks Battery - Weak - Yes

Inspector Notes
With Lto plate, with warranty booklet and jack, 3keys, no spare tire and tools, Crack headlight, scratches on taillights, battery weak