

## General Information

Date & Time: 02, Mar, 2026 11:50

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2021	<b>Odo Meter Reading</b>	158,814
<b>Registration No.</b>	ZAC1070	<b>Chassis No.</b>	PA1B18F31M4163443
<b>CC</b>	1.3	<b>Transmission</b>	M/T
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Green		

## Body / Panel Condition



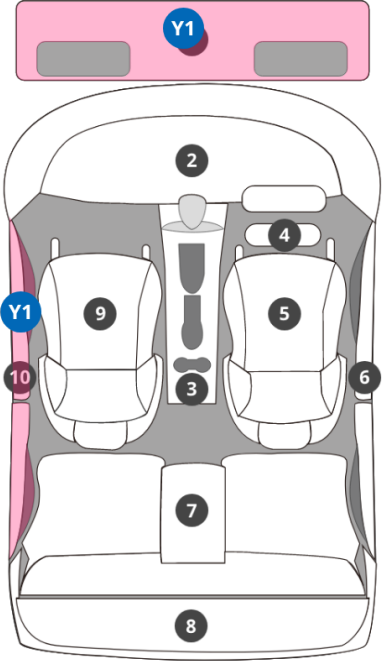
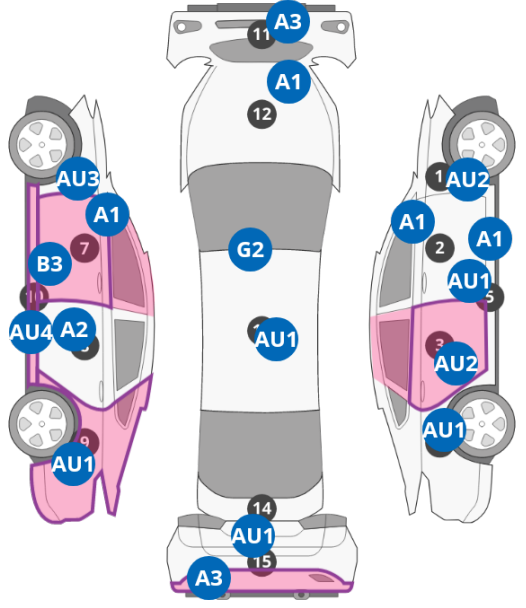
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	106.3	106	110	103
2	Boot Lid	106.2	110	98	111
3	Roof	137.9	254	99	97/102
4	Left Front Fender	177.6	102	217	214
5	Left Front Door	219.2	94	301	263
6	Center Panel Left				
7	Left Rear Door	145.7	245	95	98
8	Left Back Panel	227.6	137	403	143
9	Right Front Fender	142.6	139	141	148
10	Right Front Door	132.3	133	126	138
11	Center Panel Right				
12	Right Rear Door	144.6	153	123	158
13	Right Back Panel	139.6	129	119	171

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Ceiling - Grime - Minimal / (L) Front Trim - Grime - Minimal</p>	<p><b>Remarks</b> (R) Front Fender - Repair Traces - Yes / (L) Front Fender - Repair Traces - Yes / (L) Front Door - Repair Traces - Yes / (L) Step - Repair Traces - Yes / (L) Rear Door - Repair Traces - Yes / (L) Rear Fender - Repair Traces - Yes / Roof - Repair Traces - Yes / (R) Front Fender, Molding - Scratch &amp; Dent - Small / (R) Mirror - Scratch - Minimal / Overall Exterior - Full Re-Paint in same color - Yes / (R) Front Door, Molding - Scratch &amp; Dent - Minimal / (R) Rear Door, Molding - Repair mark - Yes / (R) Rear Door, Molding - Scratch &amp; Dent - Small / (R) Step, In-panel, Side Spoiler - Scratch - Minimal / Roof - Scratch &amp; Dent - Minimal / (R) Rear Fender, Molding - Scratch &amp; Dent - Minimal / Rear Bumper, Lamps, Panels - Repair mark - Difference in Color / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch &amp; Dent - Minimal / (L) Rear Fender, Molding - Scratch &amp; Dent - Minimal / (L) Rear Fender, Molding - Repair mark - Yes / (L) Step, In-panel, Side Spoiler - Repair mark - Yes / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Repair mark - Yes / (L) Front Door, Molding - Modified - Medium / (L) Step, In-panel, Side Spoiler - Scratch &amp; Dent - Large / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch &amp; Dent - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Scratch - Minimal / Front Windshield - Scratch, Stone chip - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>
<p><b>Remarks</b> Front Cross Member Support - Traces of Bending, or Marks of Panel Repair ? - Yes</p>	<p><b>Remarks</b> Reverse Camera - N/A - Yes / Horn - Issue - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>With Lto plate, with warranty booklet and jack, 1key, no spare tire and tools, scratches on headlights and taillights, unusual sound on engine</p>