

## General Information

Date & Time: 25, Feb, 2026 16:13

<b>Make</b>	Toyota	<b>Model</b>	Vios
<b>YOM</b>	2025	<b>Odo Meter Reading</b>	11,645
<b>Registration No.</b>	NKL3468	<b>Chassis No.</b>	PA1B18F3XR4280994
<b>CC</b>	1.3	<b>Transmission</b>	CVT
<b>Fuel Type</b>	Gas	<b>Type of Body</b>	Sedan
<b>Colour</b>	Silver		

## Body / Panel Condition



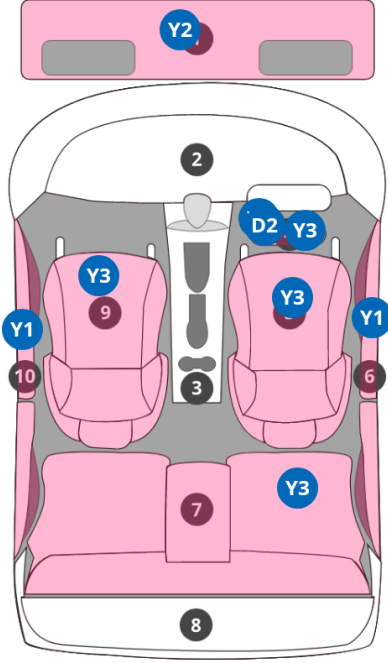
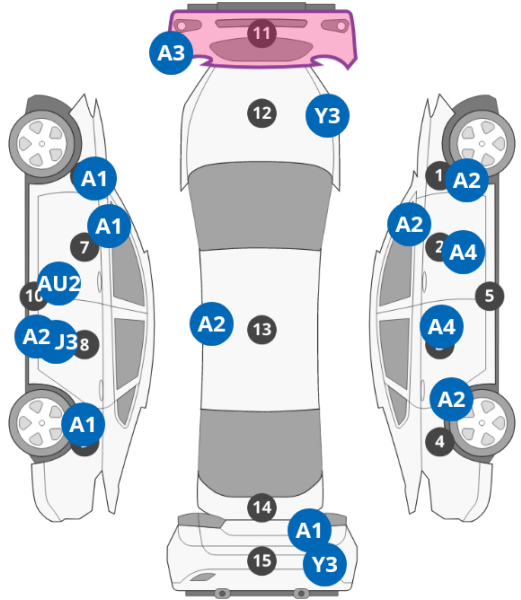
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	112.6	110	111	117
2	Boot Lid	105.3	101	101	114
3	Roof	99.6	107	102	94/96
4	Left Front Fender	101.7	98	98	110
5	Left Front Door	100.0	99	102	99
6	Center Panel Left				
7	Left Rear Door	98.7	104	98	94
8	Left Back Panel	190.3	193	194	184
9	Right Front Fender	94.6	95	90	98
10	Right Front Door	98.0	100	97	97
11	Center Panel Right				
12	Right Rear Door	106.6	117	101	102
13	Right Back Panel	102.1	105	99	103

## Overall Evaluation :

**C**

### Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

<b>Interior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">C</span>	<b>Exterior Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">E</span>
 <p><b>a</b> : Cut, Fray <b>d</b> : Loose, Deformed <b>k</b> : Animal Hair <b>s</b> : Smell <b>t</b> : Cigarette Burns <b>x</b> : Defective <b>y</b> : Stain</p>	 <p><b>A</b> : Scratch <b>AU</b> : Scratch &amp; Dent <b>B</b> : Modified <b>C</b> : Corrosion <b>G</b> : Stone chip <b>P</b> : Faded <b>S</b> : Rust <b>SC</b> : Rust &amp; Corrosion <b>U</b> : Dent <b>X</b> : Defective <b>Y</b> : Crack, Gap</p>
<p><b>Remarks</b> Rear Seat - Grime - Medium / (R) Front Seat - Grime - Medium / (L) Front Seat - Grime - Medium / (R) Front Floor Mat - Grime - Medium / (R) Front Trim - Grime - Minimal / (L) Front Trim - Grime - Minimal / (L) Front Floor Mat - Grime - Medium / Ceiling - Grime - Small / (L) Front Floor Mat - Worked - Small</p>	<p><b>Remarks</b> (L) Rear Fender - Repair Traces - Yes / (R) Mirror - Scratch - Small / (R) Front Door, Molding - Scratch - Large / (R) Front Fender, Molding - Scratch - Small / (R) Rear Door, Molding - Scratch - Large / (R) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Crack, Gap - Medium / Trunk Hood, Rear Gate - Scratch - Minimal / (L) Rear Fender, Molding - Scratch - Minimal / (L) Rear Door, Molding - Scratch &amp; Dent - Medium / (L) Front Door, Molding - Scratch &amp; Dent - Small / (L) Step, In-panel, Side Spoiler - Scratch - Small / (L) Mirror - Scratch - Minimal / (L) Front Fender, Molding - Scratch - Minimal / Front Bumper, Grille, Lamps - Repair mark - Yes / Front Bumper, Grille, Lamps - Scratch - Medium / Bonnet, Headlight - Crack, Gap - Medium / Roof - Scratch - Small</p>
<b>Frame Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">A</span>	<b>Functional Evaluation :</b> <span style="float: right; color: red; font-weight: bold;">B</span>
<p><b>Remarks</b> Defects not found</p>	<p><b>Remarks</b> Battery - Weak - Yes / Spare Key - Issue - Unexist</p>

<p><b>Inspector Notes</b></p>
<p>no warranty booklet, with jack, incomplete tools, with spare tire, with LTO plate, scratched and cracked tail light, power steering issue due to weak battery</p>