

General Information

Date & Time: 03, Mar, 2026 10:11

Make	Toyota	Model	Vios
YOM	2025	Odo Meter Reading	38,347
Registration No.	NGC9885	Chassis No.	PA1B18F33R4274177
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Black		

Body / Panel Condition



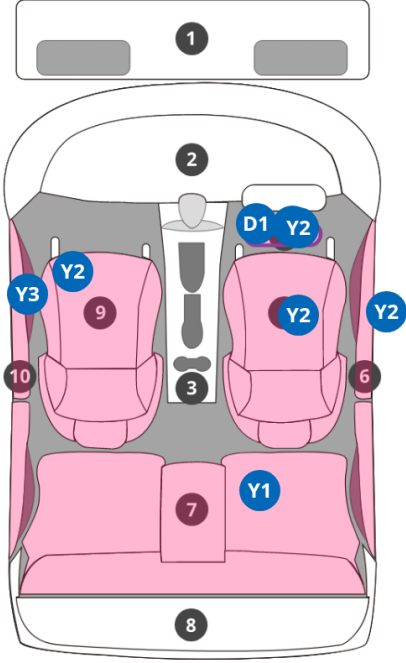
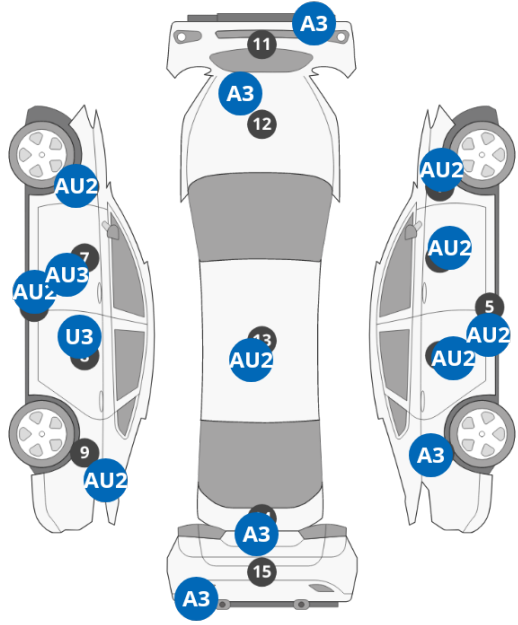
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	115.0	130	102	113
2	Boot Lid	114.8	119	99	126
3	Roof	109.9	100	147	87/106
4	Left Front Fender	101.0	102	98	103
5	Left Front Door	103.0	110	100	99
6	Center Panel Left				
7	Left Rear Door	109.0	107	108	112
8	Left Back Panel	109.0	118	107	102
9	Right Front Fender	109.9	117	113	100
10	Right Front Door	107.3	104	105	113
11	Center Panel Right				
12	Right Rear Door	115.0	105	139	101
13	Right Back Panel	107.3	96	109	117

Overall Evaluation :

C

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : B	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks (L) Front Floor Mat - Missing - Yes / (R) Front Floor Mat - Grime - Small / (L) Front Seat - Grime - Small / (R) Front Seat - Grime - Small / (L) Front Trim - Grime - Medium / (R) Front Trim - Grime - Small / Rear Seat - Grime - Minimal / Carpet - Worked - Minimal</p>	<p>Remarks (L) Rear Door, Molding - Dent - Medium / (L) Step, In-panel, Side Spoiler - Scratch & Dent - Small / (L) Front Door, Molding - Scratch & Dent - Medium / (L) Front Fender, Molding - Scratch & Dent - Small / Bonnet, Headlight - Scratch - Medium / Front Bumper, Grille, Lamps - Scratch - Medium / (R) Front Fender, Molding - Scratch & Dent - Small / (R) Front Door, Molding - Scratch & Dent - Small / (R) Rear Door, Molding - Scratch & Dent - Small / Roof - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Step, In-panel, Side Spoiler - Scratch & Dent - Small / Trunk Hood, Rear Gate - Scratch - Medium / Rear Bumper, Lamps, Panels - Scratch - Medium / (L) Rear Fender, Molding - Scratch & Dent - Small</p>
Frame Evaluation : A	Functional Evaluation : A
<p>Remarks Defects not found</p>	<p>Remarks Head Light, High Beam - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate, with spare mags, with reverse camera, with spare key, no warranty and manual booklet, scratches on taillight and headlight, issue on headlight.</p>