

General Information

Date & Time: 27, Feb, 2026 12:30

Make	Toyota	Model	Vios
YOM	2023	Odo Meter Reading	163,611
Registration No.	NHI7765	Chassis No.	PA1B18F30P4211020
CC	1.3	Transmission	CVT
Fuel Type	Gas	Type of Body	Sedan
Colour	Silver		

Body / Panel Condition



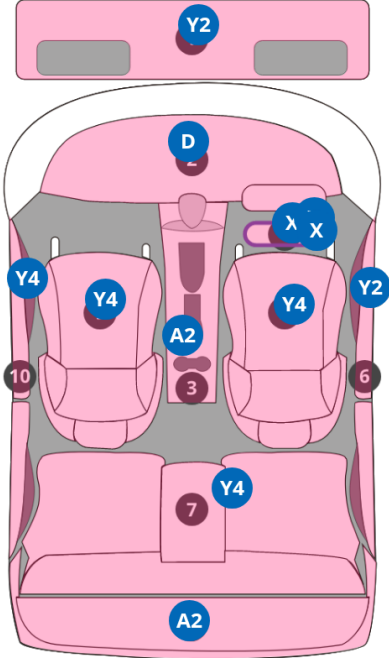
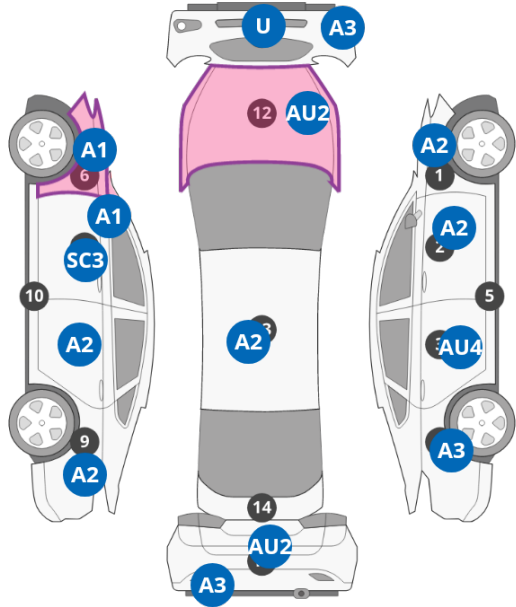
#	Area	Thickness(um)			
		Average	Value1	Value2	Value3/4
1	Bonnet	262.3	201	255	331
2	Boot Lid	108.0	111	99	114
3	Roof	104.0	110	100	100/106
4	Left Front Fender	787.3	1,162	608	592
5	Left Front Door	96.8	96	95	100
6	Center Panel Left				
7	Left Rear Door	107.3	110	110	102
8	Left Back Panel	113.0	115	105	119
9	Right Front Fender	100.1	104	98	99
10	Right Front Door	102.4	109	97	101
11	Center Panel Right				
12	Right Rear Door	107.6	105	107	111
13	Right Back Panel	102.5	100	101	107

Overall Evaluation :

D

Disclaimer

This Grading Report provides a general assessment of the condition and appearance of the vehicle's interior, exterior, and frame. It does not constitute a comprehensive inspection report. The information contained herein reflects the vehicle's condition as of the date and time indicated. This report has been prepared by the company with the utmost care and diligence. However, the company assumes no responsibility for the accuracy or completeness of the information, as the vehicle is sold "as is" and "where is." Any disputes arising from this report shall not be subject to arbitration.

Interior Evaluation : D	Exterior Evaluation : E
 <p>a : Cut, Fray d : Loose, Deformed k : Animal Hair s : Smell t : Cigarette Burns x : Defective y : Stain</p>	 <p>A : Scratch AU : Scratch & Dent B : Modified C : Corrosion G : Stone chip P : Faded S : Rust SC : Rust & Corrosion U : Dent X : Defective Y : Crack, Gap</p>
<p>Remarks Rear Seat - Grime - Large / (R) Front Seat - Grime - Large / (R) Front Trim - Grime - Small / (L) Front Trim - Grime - Large / (L) Front Seat - Grime - Large / (R) Front Floor Mat - Missing - Yes / (L) Front Floor Mat - Missing - Yes / Mat Other - Missing - Yes / Dashboard - Traces of Adhesive Tape - Yes / Trunk Room - Worn, Scratch, Cut, Crack - Small / Ceiling - Grime - Small / Console, Switches, Vents - Worn, Scratch, Cut, Crack - Small</p>	<p>Remarks Bonnet, Headlight - Scratch & Dent - Small / Roof - Scratch - Small / (L) Rear Fender, Molding - Scratch - Small / Rear Bumper, Lamps, Panels - Scratch - Medium / Trunk Hood, Rear Gate - Scratch & Dent - Small / (R) Rear Fender, Molding - Scratch - Medium / (R) Rear Door, Molding - Scratch & Dent - Large / (R) Front Door, Molding - Scratch - Small / (R) Front Fender, Molding - Scratch - Small / Front Bumper, Grille, Lamps - Scratch - Medium / (L) Front Fender, Molding - Repair mark - Yes / (L) Front Fender, Molding - Scratch - Minimal / Bonnet, Headlight - Repair mark - Yes / (L) Mirror - Scratch - Minimal / (L) Rear Door, Molding - Scratch - Small / (L) Front Door, Molding - Rust, Corrosion - Medium / Member (Bolted) - Dent - Yes</p>
Frame Evaluation : A	Functional Evaluation : B
<p>Remarks Defects not found</p>	<p>Remarks Battery - Weak - Yes / Reverse Camera - N/A - Yes / Lamps (Brake, Tail, Fog) - Issue - Yes</p>

<p>Inspector Notes</p>
<p>with LTO plate/with spare tire/with 1 spare key/with jack and incomplete tools/No seat cover/No reverse camera/plate light issue/park lights issue/front and back floor mats missing/with warranty booklet/ interior dirty/</p>